



U.S. Department
of Transportation

Federal Aviation
Administration

Office of Safety Oversight

Location of Commercial Aircraft Accidents/Incidents Relative to Runways



1. Report No. DOT/FAA/AOW 90-1		2. Government Accession No.		3. Recipient's Catalog No.	
4. Title and Subtitle Location of Aircraft Accidents/Incidents Relative to Runways				5. Report Date July 1, 1990	
				6. Performing Organization Code	
				8. Performing Organization Report No. DOT/FAA/AOW 90-1	
7. Author(s) Robert E. David, P.E.				10. Work Unit No. (TRAIS)	
9. Performing Organization Name and Address Department of Transportation Federal Aviation Administration Office of Safety Oversight Washington, D.C. 20590				11. Contract or Grant No.	
				13. Type of Report and Period Covered Final Report	
				14. Sponsoring Agency Code	
12. Sponsoring Agency Name and Address					
15. Supplementary Notes Distribution: A-W(AP/FS/AI/SE)-33; A-X(FS)-3; ZPS-344					
16. Abstract <p>The location of an aircraft involved in an accident or incident may be documented by the National Transportation Safety Board and the Federal Aviation Administration during the course of their investigation. When available, it will appear in the record of the individual investigation. However, this location information is not available from either of these agencies in a summary form.</p> <p>This study was undertaken to compile in one document the location relative to the runway of these accidents/incidents for aircraft involved in commercial air transportation in the United States. The study examined accidents/incidents that occurred from 1978 to 1987. Since it is intended that this information will be used mainly to make decisions on individual airports, no attempt was made to reach conclusions or make recommendations based on the data.</p> <p>The accidents/incidents used for this study were categorized as undershoots, landings off the runway, veeroffs, overruns, and other in the vicinity of the airport. The aircraft location was recorded in terms of the distance along the runway centerline or extended centerline (X distance) and the perpendicular distance from the centerline or extended centerline (Y distance).</p>					
17. Key Words Accident, Incident, Undershoot, Landing Off, Veeroff Overrun			18. Distribution Statement This document is available to the U.S. public through the National Technical Information Service, Springfield, VA 22161		
19. Security Classif. (of this report) Unclassified		20. Security Classif. (of this page) Unclassified		21. No. of Pages 83	22. Price

SECTION 2

APPROACH

Data Sources

The ~~National~~ Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States and its territories.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, **and includes all the** information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents **are** usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAM's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on aircraft location. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent **in the data**. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

SECTION 2

APPROACH

Data Sources

The National Transportation Safety Board (**NTSB**) is an independent agency. of the Federal Government. It is responsible for investigating, or causing to be investigated, and determining the probable cause of transportation accidents, including those involving civil aviation, that occur in the United States **and its territories**.

Any civil aviation accident occurring in the United States should have a docket. This is the **NTSB's** official record of the investigation, and includes all the information gathered on the accident.

Under its charge to conduct special investigations and special studies, the **NTSB** may also choose to investigate aviation incidents. The **NTSB** dockets for incidents are usually limited to those in which the **NTSB** has participated in the investigation.

Several incidents relevant to this study were not included in the **NTSB** dockets, but were reflected in the **FAA's** Accident/Incident Data System. These records usually do not provide specific information on aircraft location. For most of these incidents, it is probably fair to assume that the aircraft touched down or came to rest in the immediate vicinity of the runway. Because of the lack of specific location information, no attempt was made to include these incidents in this study.

One should be aware of certain limitations when using the docket information on **aircraft location**. For example, the distances given are often to a single point, such as the landing gear, the nose, the tail, or any other portion of the aircraft. In some dockets, this point is specifically identified, while in others it is not. Also, the docket usually gives no indication of how the distance was obtained: it may have been measured with a tape, paced off, or estimated by the investigative team. Consequently, there is a certain amount of error inherent in the data. Nevertheless, despite these limitations, the information contained in these dockets is considered the best available.

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these distances were measured.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable** causes, they could be grouped generically under the term "**pilot error.**"

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by "**pilot error,**" as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these distances were measured.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable** causes, they could be grouped generically under the term "**pilot error.**"

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by "**pilot error,**" as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured.**

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured.**

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured**.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured**.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured**.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured**.

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veeroff** category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veeroff** accidents and incidents is contained in Appendix **5**.

Although **veeroffs** may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veeroffs** were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

and stop on the runway. In other cases, information was available only on the aircraft's initial touchdown point. Because of this variation, the remarks for each accident/incident entry in Appendix 4 specify the points to which these **distances were measured.**

The 5 Part **121** accident/incidents in this category all occurred during Instrument Meteorological Conditions. Although the **NTSB** determined various **probable causes**, they could be grouped generically under the term **"pilot error."**

In contrast, only 1 of the 6 Part **135** accidents/incidents occurred in Instrument Meteorological Conditions. It was also caused by **"pilot error,"** as were 2 of the accidents/incidents that occurred during Visual Meteorological Conditions. The remaining **3** were attributed to mechanical difficulties.

Veeroffs

There were **97** veeroffs. Part **121** operators were involved in **38** of these accidents/incidents, while Part **135** operators were involved in the remaining **59**. The **veero**ff category does not include accidents/incidents where the aircraft veered off the side of the runway but came to rest beyond the departure end of the runway; these accidents/incidents were categorized as overruns. A listing of **veero**ff accidents and incidents is contained in Appendix **5**.

Although **veero**ffs may occur during landing or takeoff, they are more prevalent during landing. Table 1 shows how the **veero**ffs were divided between landing and takeoff for Part **121** and **135** operators.

Table 1. **Veeroffs** by Phase of Operation and Operator Type

TYPE OF OPERATOR	PHASE OF OPERATION		
	Landing	Takeoff	Total
Part 121	35	3	38
Part 135	39	20	59
Total	74	23	97

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

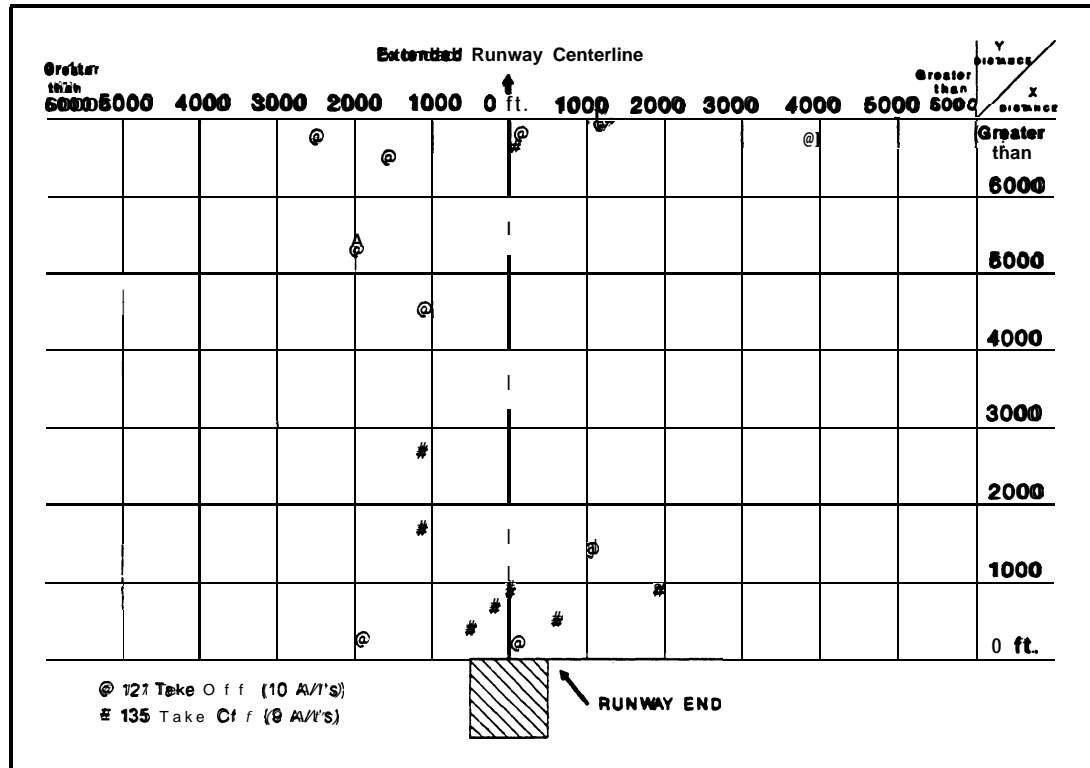


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

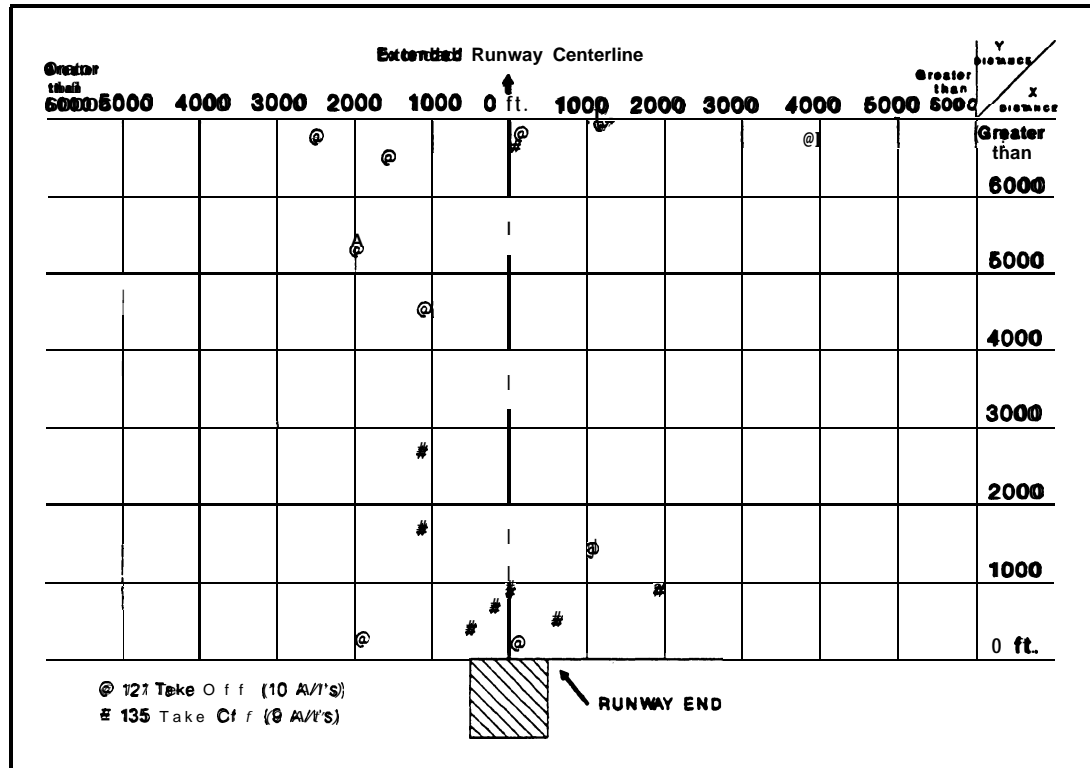


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

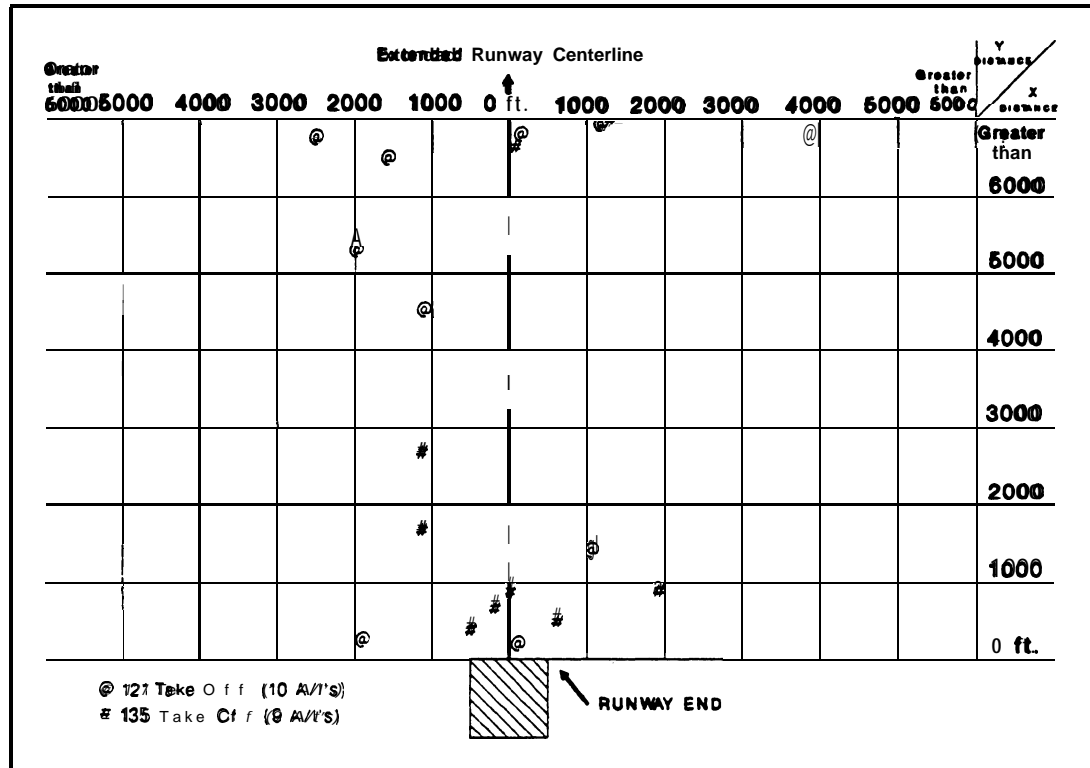


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

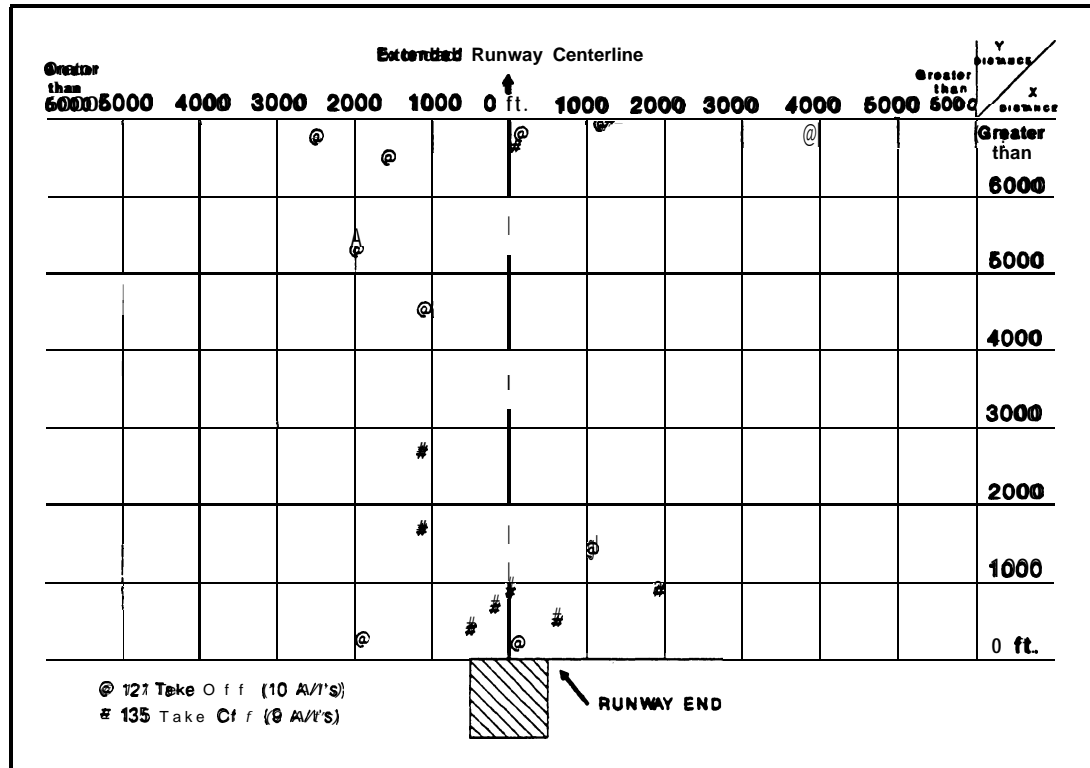


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

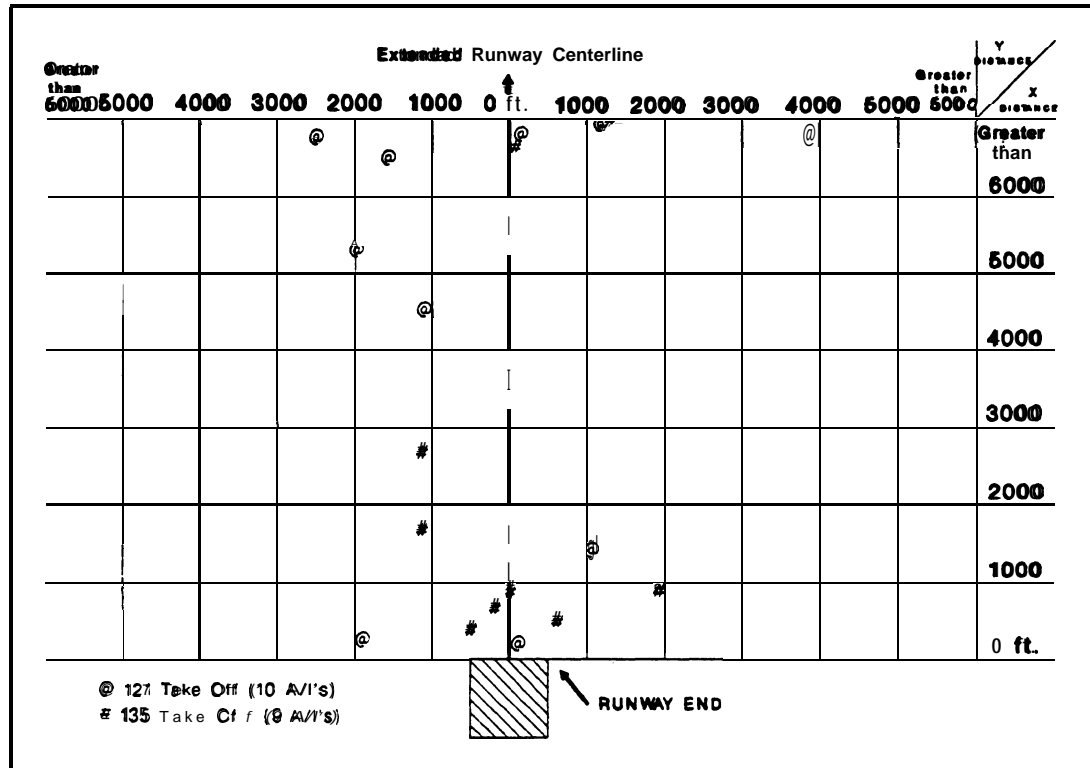


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

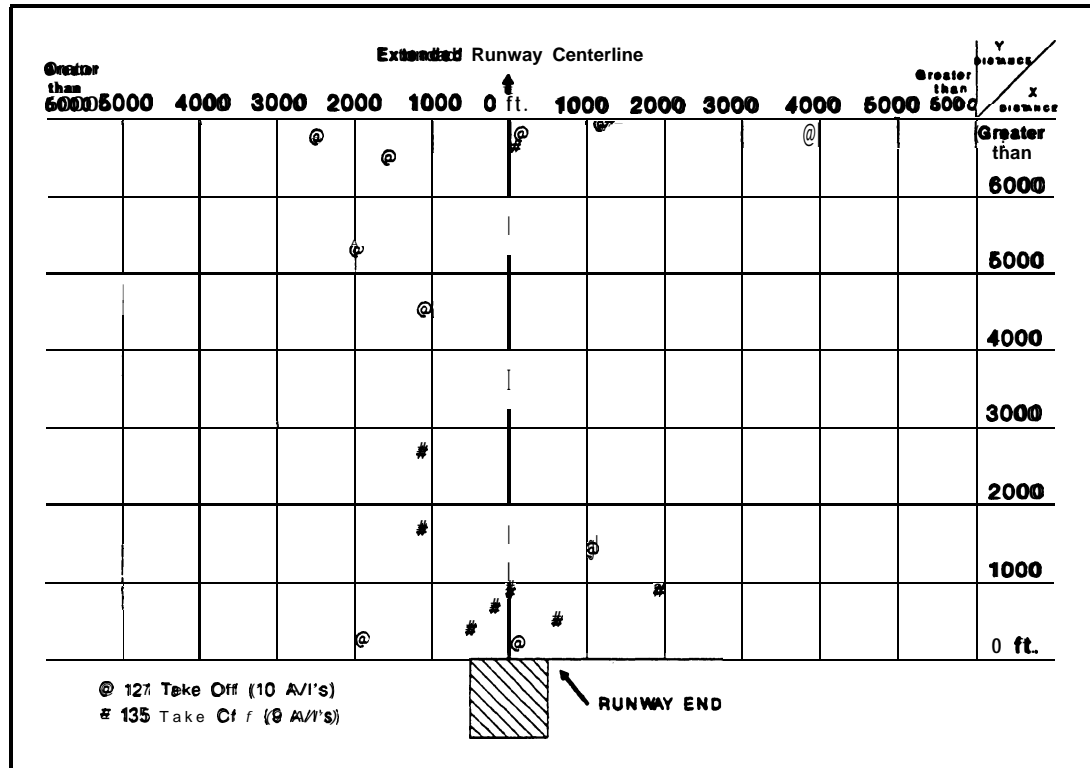


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

involving takeoff are plotted in Figure 10. Only the accidents/incidents for which both X and Y distances are known are plotted in these figures. Accidents/incidents involving takeoffs that did not pass the departure end of the runway are also not plotted. As can be seen from the figures, there is a wide disparity in aircraft accident/incident locations for this category.

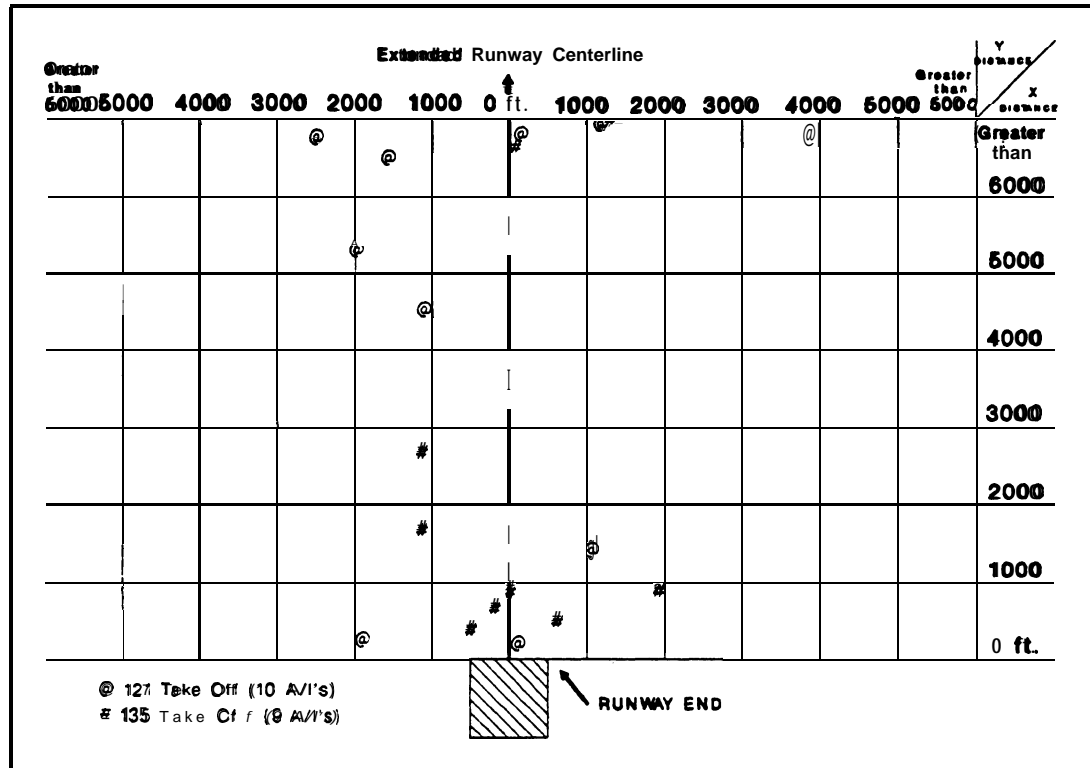


Figure 10. Other Accidents/Incidents: Takeoffs in the Vicinity of the Airport

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and FAA airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and FAA **airport** master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and FAA airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and FAA **airport** master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and **FAA** airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and **FAA airport** master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and **FAA** airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and **FAA airport** master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and **FAA** airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and **FAA** airport master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and **FAA** airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and **FAA** airport master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

approach to the airports for the cities listed in the **NTSB** docket. The information appearing in the appendix for these two accidents/incidents was taken from the docket and **FAA** airport master records.

The third double asterisk notation is for an incident listed under Washington, **D.C.** This incident was included as **part** of the **NTSB's** special investigation on runway incursions. Separate dockets were not established **for the** incidents included in the special investigation. The information in the appendix for this incident was taken from the **NTSB's** report on runway incursions and **FAA** airport master records.

Following this appendix are appendices listing accidents/incidents by **each** category--undershoots, landing offs, veeroffs, overruns, **and other. .**

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: VEER Category: VEER	Arpt Name: SAN FRANCISCO IN () Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650ABO FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-110 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS () Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/W FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT () Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI () Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: VEER Category: VEER	Arpt Name: SAN FRANCISCO IN () Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650ABO FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-110 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS () Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/W FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT () Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI () Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: Category: VEER	Arpt Name: SAN FRANCISCO IN () Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650ABO FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-110 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS () Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/W FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT () Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI () Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: Category: VEER	Arpt Name: SAN FRANCISCO IN () Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650A80 FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-10 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS () Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/180 FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT () Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI () Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: VEER Category: VEER	Arpt Name: SAN FRANCISCO IN () Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650A80 FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-10 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL () Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS () Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/180 FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT () Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI () Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI (C) Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: Category: VEER	Arpt Name: SAN FRANCISCO IN (C) Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650A80 FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-10 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS (C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/180 FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT (C) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI (C) Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON (C) Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI (C) Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: Category: VEER	Arpt Name: SAN FRANCISCO IN (C) Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMITE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650A80 FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-10 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS (C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/180 FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT (C) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI (C) Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON (C) Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

04/04/79 NEWBURG, NY Rwy ID: Lgth: 6006 Surface Type: MACADAM Category: OTHER	Arpt Name: STEWART (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: PROVIDENCE AI Rwy Surface Character: XDistance: *.25M	Acft Mfr: BEECH/E-18 FAR Part: 135 YDistance: UNK
04/16/79 MOLOKAI, HI Rwy ID: Lgth: 4493 Surface Type: MACADAM Category: OTHER	Arpt Name: MOLOKAI (C) Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ALII AIR HAWA Rwy Surface Character: XDistance: 1500	Acft Mfr: BEECH/D-18 FAR Part: 135 YDistance: UNK
04/17/79 SAN FRANCISCO, CA Rwy ID: 28 L Lgth: 10600 Surface Type: Category: VEER	Arpt Name: SAN FRANCISCO IN (C) Wid: 200 Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: YOSEMI TE AIR Rwy Surface Character: XDistance: UNK	Acft Mfr: BEECH/650A80 FAR Part: 135 YDistance: UNK
05/25/79 CHICAGO, IL Rwy ID: Lgth: 10003 Surface Type: CONCRETE Category: OTHER	Arpt Name: CHICAGO-O'HARE (C) Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: AMERICAN AIRLINES Rwy Surface Character: XDistance: 4500	Acft Mfr: DOUGLAS/DC-10 FAR Part: 121 YDistance: L1100
05/29/79 PHOENIX, AZ Rwy ID: Lgth: 10300 Surface Type: MACADAM Category: UNDER	Arpt Name: SKY HARBOR INTL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: COMBS AIRWAYS Rwy Surface Character: XDistance: 800	Acft Mfr: AERO COMDR/680-IFL FAR Part: 135 YDistance: UNK
05/30/79 ROCKLAND, ME Rwy ID: Lgth: Surface Type: Category: OTHER	Arpt Name: KNOX COUNTY RGNL (C) Wid: Rwy Status: Phase: LND	Owner Name: Operator Name/DBA: DOWNEAST AIRL Rwy Surface Character: XDistance: *1.2M	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 135 YDistance:
06/09/79 SAINT MARYS, AK Rwy ID: 16 Lgth: 6000 Surface Type: MACADAM Category: VEER	Arpt Name: ST MARYS (C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: WESTERN YUKON Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/180 FAR Part: 135 YDistance: UNK
06/11/79 ST LOUIS, MO Rwy ID: 24 Lgth: 7602 Surface Type: CONCRETE Category: VEER	Arpt Name: LAMBERT (C) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: MIDWEST AIR C Rwy Surface Character: XDistance: A2800	Acft Mfr: DEHAVILLAN/DH 104 FAR Part: 135 YDistance: D R 275
06/17/79 HYANNIS, MA Rwy ID: Lgth: 5563 Surface Type: MACADAM Category: OTHER	Arpt Name: BARNSTABLE MUNI (C) Wid: Rwy Status: WET Phase: LND	Owner Name: Operator Name/DBA: AIR NEW ENGLA Rwy Surface Character: XDistance: 9000	Acft Mfr: DEHAVILLAN/DHC-6 FAR Part: 121 YDistance: 0
07/24/79 ST CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON (C) Wid: Rwy Status: Phase: T/O	Owner Name: Operator Name/DBA: PRINAIR Rwy Surface Character: XDistance: 5500 APP	Acft Mfr: DEHAVILLAN/DH-114 FAR Part: 135 YDistance: R 792

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arpt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arpt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arpt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arpt Name: METRO () Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arpt Name: INDIANAPOLIS INTERN. (IND) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arpt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arpt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arpt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arpt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arpt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arprt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arprt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arprt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arprt Name: METRO (I) Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arprt Name: INDIANAPOLIS INTERN. (IND) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arprt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arprt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arprt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arprt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arprt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arpt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arpt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arpt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arpt Name: METRO (I) Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arpt Name: INDIANAPOLIS INTERN. (IND) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arpt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arpt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arpt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arpt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arpt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arprt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arprt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arprt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arprt Name: METRO () Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arprt Name: INDIANAPOLIS INTERN. (IND) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arprt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arprt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arprt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arprt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arprt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arprt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arprt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arprt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arprt Name: METRO (I) Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arprt Name: INDIANAPOLIS INTERN. (IWO) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arprt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arprt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arprt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arprt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arprt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

Appendix 2. CHRONOLOGICAL LISTING OF ACCIDENTS/INCIDENTS

PAGE 41

07/05/82 BOISE, ID Rwy ID: 28 Lgth: 9763 Surface Type: ASPHALT Category: OVER	Arprt Name: BOISE AIR TERMINAL (BOI) Wid: 190 Rwy Status: DRY Phase: T/O	Owner Name: REPUBLIC AIRLINES WEST, INC. Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: 50	Acft Mfr: DOUGLAS/DG-931 FAR Part: 121 SCHEDULED YDistance: UNK
07/09/82 NEW ORLEANS, LA Rwy ID: 10 Lgth: 9227 Surface Type: CONCRETE Category: OTHER	Arprt Name: C) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: PAN AMERICAN WORLD A/U Operator Name/DBA: Rwy Surface Character: POROUS XDistance: *.75NM	Acft Mfr: BOEING/727-235 FAR Part: 121 SCHEDULED YDistance:
08/12/82 NORTH PLATTE, NE Rwy ID: 30 Lgth: 8000 Surface Type: CONCRETE Category: L OFF	Arprt Name: LEE BIRD FIELD (LBF) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: FRONTIER AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2230	Acft Mfr: BOEING/737-291 FAR Part: 121 SCHEDULED YDistance: R 100
09/02/82 FAIRBANKS, AK Rwy ID: 6 Lgth: 4600 Surface Type: ASPHALT Category: VEER	Arprt Name: METRO () Wid: 100 Rwy Status: DRY Phase: T/O	Owner Name: GREG HAVES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 220 B1570	Acft Mfr: CESSNA/402 FAR Part: 135 SCHEDULED YDistance: D L 50
09/17/82 INDIANAPOLIS, IN Rwy ID: 31 Lgth: 7604 Surface Type: ASPHALT Category: OTHER	Arprt Name: INDIANAPOLIS INTERN. (IWO) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: INDIANAPOLIS AIR CHARTER, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 2700 APP	Acft Mfr: BEECH/G18S FAR Part: 135 SCHEDULED YDistance: UNK
11/04/82 NELSON LAGOON, AK Rwy ID: 26 Lgth: 3100 Surface Type: DIRT Category: UNDER	Arprt Name: NELSON LAGOON (273) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: NORTHERN AIR CARGO, INC. Operator Name/DBA: Rwy Surface Character: GROUND XDistance: 51	Acft Mfr: FAIRCHILD/C-82 FAR Part: 121 NW-SCHEDULED YDistance: 0
11/22/82 LITTLE ROCK, AR Rwy ID: 22 Lgth: 7012 Surface Type: CONCRETE Category: VEER	Arprt Name: ADAMS (LIT) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: AMERICAN AIRLINES Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: A2000 C3400	Acft Mfr: BOEING/727-223 FAR Part: 121 SCHEDULED YDistance: E L 100
11/26/82 GUSTAVUS, AK Rwy ID: 1 Lgth: 5400 Surface Type: ASPHALT Category: OVER	Arprt Name: GUSTAVUS (GST) Wid: 340 Rwy Status: SNOW-WET Phase: T/O	Owner Name: LAYTON A. BENNETT Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: UNK	Acft Mfr: PIPER/PA-32R-300 FAR Part: 135 SCHEDULED YDistance: UNK
12/18/82 PELLSTON, MI Rwy ID: 32 Lgth: 6512 Surface Type: ASPHALT Category: OVER	Arprt Name: EMMET COUNTY AIRPORT (PLN) Wid: 150 Rwy Status: ICE COVERED Phase: LND	Owner Name: REPUBLIC AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 80	Acft Mfr: DOUGLAS/DG-930 FAR Part: 121 SCHEDULED YDistance: 0
12/20/82 GILLETTE, WY Rwy ID: 15 Lgth: 6500 Surface Type: ASPHALT Category: VEER	Arprt Name: GILLETTE CAMPBELL COUNT (GCC) Wid: 75 Rwy Status: Phase: T/O	Owner Name: PIONEER AIRLINES Operator Name/DBA: Rwy Surface Character: SMOOTH TEXTURE XDistance: A 400 B 850	Acft Mfr: SWEARINGEN/SA-227AC FAR Part: 135 SCHEDULED YDistance: D R 160

04/28/85	AMARILLO, TX	Arpt Name: AMARILLO INTL (AMA)	Owner Name: SOUTHWEST AIRLINES CO.	Acft Mfr.: BOEING/737-300
Rwy ID: 4	Lgth: 13502	Wid: 300	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET RUBBER DEPOSITS	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: 87500	YDistance: L UNK
05/06/85	WEST PALM BEACH, FL	Arpt Name: PALM BEACH INTL (PBI)	Owner Name: INTERNATIONAL AIRCRAFT CORP.	Acft Mfr.: BEECH/E185
Rwy ID: 13	Lgth: 6930	Wid: 150	Operator Name/DBA: AIRSOUTH, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: L OFF		Phase: LND	XDistance: 5900	YDistance: R 600
05/17/85	LATROBE, PA	Arpt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr.: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arpt Name: NASHVILLE METRO (BNA)	Owner Name: TAC	Acft Mfr.: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arpt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr.: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NON-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
06/27/85	SAN JUAN, PR	Arpt Name: LUIS MUNOZ MARIU INT'L (SJV)	Owner Name: AMERICAN AIRLINES, INC.	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10
Rwy ID: 8	Lgth: 10002	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OVER		Phase: T/O	XDistance: 62	YDistance: L 160
08/02/85	DALLAS/FORT WORTH, TX	Arpt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr.: LOCKHEED/L-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/07/85	MOLINE, IL	Arpt Name: QUAD CITY (MCI)	Owner Name: MIDWEST AVIATION CORP.	Acft Mfr.: CESSNA/402B
Rwy ID: 27	Lgth: 6507	Wid: 150	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: UNDER		Phase: LND	XDistance: 1500	YDistance: 0
08/25/85	AUBURN, ME	Arpt Name: AUBURN-LEWISTON MUNI O	Owner Name: BAR HARBOR AIRLINES	Acft Mfr.: BEECH/99
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
08/28/85	GREEN BAY, WI	Arpt Name: AUSTIN STRAUBEL FLD (GRB)	Owner Name: SEC. PACIFIC COM LEASING INC.	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20
Rwy ID: 36	Lgth: 6000	Wid: 150	Operator Name/DBA: AIR WISCONSIN	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: OVER		Phase: LND	XDistance: UNK	YDistance: 0

04/28/85 AMARILLO, TX Rwy ID: 4 Lgth: 13502 Surface Type: ASPHALT Category: VEER	Arpt Name: AMARILLO INTL (AMA) Wid: 300 Rwy Status: WET RUBBER DEPOSITS Phase: LND	Owner Name: SOUTHWEST AIRLINES CO. Operator Name/DBA: Rwy Surface Character: XDistance: 87500	Acft Mfr: BOEING/737-300 FAR Part: 121 SCHEDULED YDistance: L UNK
05/06/85 WEST PALM BEACH, FL Rwy ID: 13 Lgth: 6930 Surface Type: ASPHALT Category: L OFF	Arpt Name: PALM BEACH INTL (PSI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: INTERNATIONAL AIRCRAFT CORP. Operator Name/DBA: AIRSOUTH, INC. Rwy Surface Character: XDistance: 5900	Acft Mfr: BEECH/E18S FAR Part: 135 SCHEDULED YDistance: R 600
05/17/85 LATROBE, PA Rwy ID: 23 Lgth: 5501 Surface Type: ASPHALT Category: OTHER	Arpt Name: WESTMORELAND COUNTY (LBE) Wid: 100 Rwy Status: WET Phase: LND	Owner Name: CUMBERLAND AIRLINES Operator Name/DBA: CUMBERLAND AIRLINES Rwy Surface Character: XDistance: *3.8M SE APT	Acft Mfr: PIPER/PA-31-350 FAR Part: 135 SCHEDULED YDistance:
05/31/85 NASHVILLE, TN Rwy ID: 20 R Lgth: 7700 Surface Type: CONCRETE Category: OTHER	Arpt Name: NASHVILLE METRO (BNA) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: ITAG Operator Name/DBA: GENERAL AVIATION, INC. Rwy Surface Character: XDistance: 100	Acft Mfr: GULFSTREAM/G-159 FAR Part: 121 SCHEDULED YDistance: L1720
06/19/85 WEST TRENTON, NJ Rwy ID: 24 Lgth: 6006 Surface Type: CONCRETE Category: OTHER	Arpt Name: MERCER COUNTY (TTN) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: PROVIDENCE AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 5280	Acft Mfr: GENERAL DYNAMICS/240-27 FAR Part: 121 NON-SCHEDULED YDistance: L2000
06/27/85 SAN JUAN, PR Rwy ID: 8 Lgth: 10002 Surface Type: ASPHALT Category: OVER	Arpt Name: LUIS MUNOZ MARIN INT'L (SJV) Wid: 200 Rwy Status: DRY Phase: T/O	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 62	Acft Mfr: MCDONNELL DOUGLAS/DC-10-10 FAR Part: 121 SCHEDULED YDistance: L 160
08/02/85 DALLAS/FORT WORTH, TX Rwy ID: 17 L Lgth: 11388 Surface Type: CONCRETE Category: OTHER	Arpt Name: DALLAS/FORT WORTH INTL (DFW) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: DELTA AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 6336	Acft Mfr: LOCKHEED/L-1011-385-11 FAR Part: 121 SCHEDULED YDistance: L 360
08/07/85 MOBILE, IL Rwy ID: 27 Lgth: 6507 Surface Type: ASPHALT Category: UNDER	Arpt Name: QUAD CITY (MCI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: MIDWEST AVIATION CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 1500	Acft Mfr: CESSNA/402B FAR Part: 135 SCHEDULED YDistance: 0
08/25/85 AUBURN, ME Rwy ID: 4 Lgth: 5000 Surface Type: ASPHALT Category: OTHER	Arpt Name: AUBURN-LEWISTON MUNI O Wid: 75 Rwy Status: WET Phase: LND	Owner Name: BAR HARBOR AIRLINES Operator Name/DBA: Rwy Surface Character: POROUS SMOOTH XDistance: 3246	Acft Mfr: BEECH/99 FAR Part: 135 SCHEDULED YDistance: R 441
08/28/85 GREEN BAY, WI Rwy ID: 36 Lgth: 6000 Surface Type: CONCRETE Category: OVER	Arpt Name: AUSTIN STRAUBEL FLD (GRB) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: SEC. PACIFIC COM LEASING INC. Operator Name/DBA: AIR WISCONSIN Rwy Surface Character: XDistance: UNK	Acft Mfr: BRITISH AEROSPACE/BAC 1-11-20 FAR Part: 121 SCHEDULED YDistance: 0

04/28/85 AMARILLO, TX Rwy ID: 4 Lgth: 13502 Surface Type: ASPHALT Category: VEER	Arpt Name: AMARILLO INTL (AMA) Wid: 300 Rwy Status: WET RUBBER DEPOSITS Phase: LND	Owner Name: SOUTHWEST AIRLINES CO. Operator Name/DBA: Rwy Surface Character: XDistance: 87500	Acft Mfr.: BOEING/737-300 FAR Part: 121 SCHEDULED YDistance: L UNK
05/06/85 WEST PALM BEACH, FL Rwy ID: 13 Lgth: 6930 Surface Type: ASPHALT Category: L OFF	Arpt Name: PALM BEACH INTL (PSI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: INTERNATIONAL AIRCRAFT CORP. Operator Name/DBA: AIRSOUTH, INC. Rwy Surface Character: XDistance: 5900	Acft Mfr.: BEECH/E185 FAR Part: 135 SCHEDULED YDistance: R 600
05/17/85 LATROBE, PA Rwy ID: 23 Lgth: 5501 Surface Type: ASPHALT Category: OTHER	Arpt Name: WESTMORELAND COUNTY (LBE) Wid: 100 Rwy Status: WET Phase: LND	Owner Name: CUMBERLAND AIRLINES Operator Name/DBA: CUMBERLAND AIRLINES Rwy Surface Character: XDistance: *3.8M SE APT	Acft Mfr.: PIPER/PA-31-350 FAR Part: 135 SCHEDULED YDistance:
05/31/85 NASHVILLE, TN Rwy ID: 20 R Lgth: 7700 Surface Type: CONCRETE Category: OTHER	Arpt Name: NASHVILLE METRO (BNA) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: ITAG Operator Name/DBA: GENERAL AVIATION, INC. Rwy Surface Character: XDistance: 100	Acft Mfr.: GULFSTREAM/G-159 FAR Part: 121 SCHEDULED YDistance: L1720
06/19/85 WEST TRENTON, NJ Rwy ID: 24 Lgth: 6006 Surface Type: CONCRETE Category: OTHER	Arpt Name: MERCER COUNTY (TTN) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: PROVIDENCE AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 5280	Acft Mfr.: GENERAL DYNAMICS/240-27 FAR Part: 121 NON-SCHEDULED YDistance: L2000
06/27/85 SAN JUAN, PR Rwy ID: 8 Lgth: 10002 Surface Type: ASPHALT Category: OVER	Arpt Name: LUIS MUNOZ MARIQUINT'L (SJV) Wid: 200 Rwy Status: DRY Phase: T/O	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 62	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10 FAR Part: 121 SCHEDULED YDistance: L 160
08/02/85 DALLAS/FORT WORTH, TX Rwy ID: 17 L Lgth: 11388 Surface Type: CONCRETE Category: OTHER	Arpt Name: DALLAS/FORT WORTH INTL (DFW) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: DELTA AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 6336	Acft Mfr.: LOCKHEED/L-1011-385-11 FAR Part: 121 SCHEDULED YDistance: L 360
08/07/85 MOBILE, IL Rwy ID: 27 Lgth: 6507 Surface Type: ASPHALT Category: UNDER	Arpt Name: QUAD CITY (MCI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: MIDWEST AVIATION CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 1500	Acft Mfr.: CESSNA/402B FAR Part: 135 SCHEDULED YDistance: 0
08/25/85 AUBURN, ME Rwy ID: 4 Lgth: 5000 Surface Type: ASPHALT Category: OTHER	Arpt Name: AUBURN-LEWISTON MUNI O Wid: 75 Rwy Status: WET Phase: LND	Owner Name: BAR HARBOR AIRLINES Operator Name/DBA: Rwy Surface Character: POROUS SMOOTH XDistance: 3246	Acft Mfr.: BEECH/99 FAR Part: 135 SCHEDULED YDistance: R 441
08/28/85 GREEN BAY, WI Rwy ID: 36 Lgth: 6000 Surface Type: CONCRETE Category: OVER	Arpt Name: AUSTIN STRAUBEL FLD (GRB) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: SEC. PACIFIC COM LEASING INC. Operator Name/DBA: AIR WISCONSIN Rwy Surface Character: XDistance: UNK	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20 FAR Part: 121 SCHEDULED YDistance: 0

04/28/85 AMARILLO, TX Rwy ID: 4 Lgth: 13502 Surface Type: ASPHALT Category: VEER	Arpt Name: AMARILLO INTL (AMA) Wid: 300 Rwy Status: WET RUBBER DEPOSITS Phase: LND	Owner Name: SOUTHWEST AIRLINES CO. Operator Name/DBA: Rwy Surface Character: XDistance: 87500	Acft Mfr: BOEING/737-300 FAR Part: 121 SCHEDULED YDistance: L UNK
05/06/85 WEST PALM BEACH, FL Rwy ID: 13 Lgth: 6930 Surface Type: ASPHALT Category: L OFF	Arpt Name: PALM BEACH INTL (PSI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: INTERNATIONAL AIRCRAFT CORP. Operator Name/DBA: AIRSOUTH , INC. Rwy Surface Character: XDistance: 5900	Acft Mfr: BEECH/E185 FAR Part: 135 SCHEDULED YDistance: R 600
05/17/85 LATROBE, PA Rwy ID: 23 Lgth: 5501 Surface Type: ASPHALT Category: OTHER	Arpt Name: WESTMORELAND COUNTY (LBE) Wid: 100 Rwy Status: WET Phase: LND	Owner Name: CUMBERLAND AIRLINES Operator Name/DBA: CUMBERLAND AIRLINES Rwy Surface Character: XDistance: *3.8M SE APT	Acft Mfr: PIPER/PA-31-350 FAR Part: 135 SCHEDULED YDistance:
05/31/85 NASHVILLE, TN Rwy ID: 20 R Lgth: 7700 Surface Type: CONCRETE Category: OTHER	Arpt Name: NASHVILLE METRO (BNA) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: ITAG Operator Name/DBA: GENERAL AVIATION , INC. Rwy Surface Character: XDistance: 100	Acft Mfr: GULFSTREAM/G-159 FAR Part: 121 SCHEDULED YDistance: L1720
06/19/85 WEST TRENTON, NJ Rwy ID: 24 Lgth: 6006 Surface Type: CONCRETE Category: OTHER	Arpt Name: MERCER COUNTY (TTN) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: PROVIDENCE AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 5280	Acft Mfr: GENERAL DYNAMICS/240-27 FAR Part: 121 NON-SCHEDULED YDistance: L2000
06/27/85 SAN JUAN, PR Rwy ID: 8 Lgth: 10002 Surface Type: ASPHALT Category: OVER	Arpt Name: LUIS MUNOZ MARIN INT'L (SJV) Wid: 200 Rwy Status: DRY Phase: T/O	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: 62	Acft Mfr: MCDONNELL DOUGLAS/DC-10-10 FAR Part: 121 SCHEDULED YDistance: L 160
08/02/85 DALLAS/FORT WORTH, TX Rwy ID: 17 L Lgth: 11388 Surface Type: CONCRETE Category: OTHER	Arpt Name: DALLAS/FORT WORTH INTL (DFW) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: DELTA AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: 6336	Acft Mfr: LOCKHEED/L-1011-385-11 FAR Part: 121 SCHEDULED YDistance: L 360
08/07/85 MOLINE, IL Rwy ID: 27 Lgth: 6507 Surface Type: ASPHALT Category: UNDER	Arpt Name: QUAD CITY (MCI) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: MIDWEST AVIATION CORP. Operator Name/DBA: Rwy Surface Character: XDistance: 1500	Acft Mfr: CESSNA/402B FAR Part: 135 SCHEDULED YDistance: 0
08/25/85 AUBURN, ME Rwy ID: 4 Lgth: 5000 Surface Type: ASPHALT Category: OTHER	Arpt Name: AUBURN-LEWISTON MUNI 0 Wid: 75 Rwy Status: WET Phase: LND	Owner Name: BAR HARBOR AIRLINES Operator Name/DBA: Rwy Surface Character: POROUS SMOOTH XDistance: 3246	Acft Mfr: BEECH/99 FAR Part: 135 SCHEDULED YDistance: R 441
08/28/85 GREEN BAY, WI Rwy ID: 36 Lgth: 6000 Surface Type: CONCRETE Category: OVER	Arpt Name: AUSTIN STRAUBEL FLD (GRB) Wid: 150 Rwy Status: WET Phase: LND	Owner Name: SEC. PACIFIC COM LEASING INC. Operator Name/DBA: AIR WISCONSIN Rwy Surface Character: XDistance: UNK	Acft Mfr: BRITISH AEROSPACE/BAC 1-11-20 FAR Part: 121 SCHEDULED YDistance: 0

04/28/85	AMARILLO, TX	Arpt Name: AMARILLO INTL (AMA)	Owner Name: SOUTHWEST AIRLINES CO.	Acft Mfr.: BOEING/737-300
Rwy ID: 4	Lgth: 13502	Wid: 300	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET RUBBER DEPOSITS	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: 87500	YDistance: L UNK
05/06/85	WEST PALM BEACH, FL	Arpt Name: PALM BEACH INTL (PSI)	Owner Name: INTERNATIONAL AIRCRAFT CORP.	Acft Mfr.: BEECH/E185
Rwy ID: 13	Lgth: 6930	Wid: 150	Operator Name/DBA: AIRSOUTH, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: L OFF		Phase: LND	XDistance: 5900	YDistance: R 600
05/17/85	LATROBE, PA	Arpt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr.: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arpt Name: NASHVILLE METRO (BNA)	Owner Name: ITAG	Acft Mfr.: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arpt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr.: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NON-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
06/27/85	SAN JUAN, PR	Arpt Name: LUIS MUNOZ MARIQUINT'L (SJV)	Owner Name: AMERICAN AIRLINES, INC.	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10
Rwy ID: 8	Lgth: 10002	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OVER		Phase: T/O	XDistance: 62	YDistance: L 160
08/02/85	DALLAS/FORT WORTH, TX	Arpt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr.: LOCKHEED/L-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/07/85	MOLINE, IL	Arpt Name: QUAD CITY (MCI)	Owner Name: MIDWEST AVIATION CORP.	Acft Mfr.: CESSNA/402B
Rwy ID: 27	Lgth: 6507	Wid: 150	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: UNDER		Phase: LND	XDistance: 1500	YDistance: 0
08/25/85	AUBURN, ME	Arpt Name: AUBURN-LEWISTON MUNI 0	Owner Name: BAR HARBOR AIRLINES	Acft Mfr.: BEECH/99
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
08/28/85	GREEN BAY, WI	Arpt Name: AUSTIN STRAUBEL FLD (GRB)	Owner Name: SEC. PACIFIC COM LEASING INC.	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20
Rwy ID: 36	Lgth: 6000	Wid: 150	Operator Name/DBA: AIR WISCONSIN	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: OVER		Phase: LND	XDistance: UNK	YDistance: 0

04/28/85	AMARILLO, TX	Arpt Name: AMARILLO INTL (AMA)	Owner Name: SOUTHWEST AIRLINES CO.	Acft Mfr.: BOEING/737-300
Rwy ID: 4	Lgth: 13502	Wid: 300	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET RUBBER DEPOSITS	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: 87500	YDistance: L UNK
05/06/85	WEST PALM BEACH, FL	Arpt Name: PALM BEACH INTL (PSI)	Owner Name: INTERNATIONAL AIRCRAFT CORP.	Acft Mfr.: BEECH/E185
Rwy ID: 13	Lgth: 6930	Wid: 150	Operator Name/DBA: AIRSOUTH, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: L OFF		Phase: LND	XDistance: 5900	YDistance: R 600
05/17/85	LATROBE, PA	Arpt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr.: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arpt Name: NASHVILLE METRO (BNA)	Owner Name: ITAG	Acft Mfr.: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arpt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr.: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NON-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
06/27/85	SAN JUAN, PR	Arpt Name: LUIS MUNOZ MARIQUINT'L (SJV)	Owner Name: AMERICAN AIRLINES, INC.	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10
Rwy ID: 8	Lgth: 10002	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OVER		Phase: T/O	XDistance: 62	YDistance: L 160
08/02/85	DALLAS/FORT WORTH, TX	Arpt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr.: LOCKHEED/L-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/07/85	MOLINE, IL	Arpt Name: QUAD CITY (MCI)	Owner Name: MIDWEST AVIATION CORP.	Acft Mfr.: CESSNA/402B
Rwy ID: 27	Lgth: 6507	Wid: 150	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: UNDER		Phase: LND	XDistance: 1500	YDistance: 0
08/25/85	AUBURN, ME	Arpt Name: AUBURN-LEWISTON MUNI 0	Owner Name: BAR HARBOR AIRLINES	Acft Mfr.: BEECH/99
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
08/28/85	GREEN BAY, WI	Arpt Name: AUSTIN STRAUBEL FLD (GRB)	Owner Name: SEC. PACIFIC COM LEASING INC.	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20
Rwy ID: 36	Lgth: 6000	Wid: 150	Operator Name/DBA: AIR WISCONSIN	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: OVER		Phase: LND	XDistance: UNK	YDistance: 0

04/28/85	AMARILLO, TX	Arpt Name: AMARILLO INTL (AMA)	Owner Name: SOUTHWEST AIRLINES CO.	Acft Mfr.: BOEING/737-300
Rwy ID: 4	Lgth: 13502	Wid: 300	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET RUBBER DEPOSITS	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: 87500	YDistance: L UNK
05/06/85	WEST PALM BEACH, FL	Arpt Name: PALM BEACH INTL (PSI)	Owner Name: INTERNATIONAL AIRCRAFT CORP.	Acft Mfr.: BEECH/E185
Rwy ID: 13	Lgth: 6930	Wid: 150	Operator Name/DBA: AIRSOUTH, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: L OFF		Phase: LND	XDistance: 5900	YDistance: R 600
05/17/85	LATROBE, PA	Arpt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr.: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arpt Name: NASHVILLE METRO (BNA)	Owner Name: ITAG	Acft Mfr.: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arpt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr.: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NON-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
06/27/85	SAN JUAN, PR	Arpt Name: LUIS MUNOZ MARIQUINT'L (SJV)	Owner Name: AMERICAN AIRLINES, INC.	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10
Rwy ID: 8	Lgth: 10002	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OVER		Phase: T/O	XDistance: 62	YDistance: L 160
08/02/85	DALLAS/FORT WORTH, TX	Arpt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr.: LOCKHEED/L-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/07/85	MOLINE, IL	Arpt Name: QUAD CITY (MCI)	Owner Name: MIDWEST AVIATION CORP.	Acft Mfr.: CESSNA/402B
Rwy ID: 27	Lgth: 6507	Wid: 150	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: UNDER		Phase: LND	XDistance: 1500	YDistance: 0
08/25/85	AUBURN, ME	Arpt Name: AUBURN-LEWISTON MUNI 0	Owner Name: BAR HARBOR AIRLINES	Acft Mfr.: BEECH/99
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
08/28/85	GREEN BAY, WI	Arpt Name: AUSTIN STRAUBEL FLD (GRB)	Owner Name: SEC. PACIFIC COM LEASING INC.	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20
Rwy ID: 36	Lgth: 6000	Wid: 150	Operator Name/DBA: AIR WISCONSIN	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: OVER		Phase: LND	XDistance: UNK	YDistance: 0

04/28/85	AMARILLO, TX	Arpt Name: AMARILLO INTL (AMA)	Owner Name: SOUTHWEST AIRLINES CO.	Acft Mfr.: BOEING/737-300
Rwy ID: 4	Lgth: 13502	Wid: 300	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET RUBBER DEPOSITS	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: 87500	YDistance: L UNK
05/06/85	WEST PALM BEACH, FL	Arpt Name: PALM BEACH INTL (PSI)	Owner Name: INTERNATIONAL AIRCRAFT CORP.	Acft Mfr.: BEECH/E185
Rwy ID: 13	Lgth: 6930	Wid: 150	Operator Name/DBA: AIRSOUTH, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: L OFF		Phase: LND	XDistance: 5900	YDistance: R 600
05/17/85	LATROBE, PA	Arpt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr.: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arpt Name: NASHVILLE METRO (BNA)	Owner Name: ITAG	Acft Mfr.: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arpt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr.: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NON-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
06/27/85	SAN JUAN, PR	Arpt Name: LUIS MUNOZ MARIQUINT'L (SJV)	Owner Name: AMERICAN AIRLINES, INC.	Acft Mfr.: MCDONNELL DOUGLAS/DC-10-10
Rwy ID: 8	Lgth: 10002	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OVER		Phase: T/O	XDistance: 62	YDistance: L 160
08/02/85	DALLAS/FORT WORTH, TX	Arpt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr.: LOCKHEED/L-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/07/85	MOLINE, IL	Arpt Name: QUAD CITY (MCI)	Owner Name: MIDWEST AVIATION CORP.	Acft Mfr.: CESSNA/402B
Rwy ID: 27	Lgth: 6507	Wid: 150	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: UNDER		Phase: LND	XDistance: 1500	YDistance: 0
08/25/85	AUBURN, ME	Arpt Name: AUBURN-LEWISTON MUNI 0	Owner Name: BAR HARBOR AIRLINES	Acft Mfr.: BEECH/99
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
08/28/85	GREEN BAY, WI	Arpt Name: AUSTIN STRAUBEL FLD (GRB)	Owner Name: SEC. PACIFIC COM LEASING INC.	Acft Mfr.: BRITISH AEROSPACE/BAC 1-11-20
Rwy ID: 36	Lgth: 6000	Wid: 150	Operator Name/DBA: AIR WISCONSIN	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: OVER		Phase: LND	XDistance: UNK	YDistance: 0

12/07/78 ROCKFORD, IL Arpt Name: GREATER ROCKFORD (I) Owner Name: Acft Mfr: CESSNA/401A
 Rwy ID: 36 Lgth: 8198 Wid: Operator Name/DBA: INTERNATL AVI FAR Part: 135
 Surface Type: MACADAM Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: CND XDistance: 837 YDistance: R 325
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER PREFLIGHT.

05/29/82 DETROIT, MI Arpt Name: DETROIT METROPOLITAN (DTW) Owner Name: PROVIDENCE AIRLINES CORPORATION Acft Mfr: CONVAIR/240
 Rwy ID: 27 Lgth: 8700 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: SMOOTH TEXTURE Rwy Status: WET
 Category: L OFF Phase: LND XDistance: UNK YDistance: UNK
 REMARKS: INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER RAISING OF FLAPS.

08/12/82 NORTH PLATTE, NE Arpt Name: LEE BIRD FIELD (LBF) Owner Name: FRONTIER AIRLINES Acft Mfr: BOEING/737-2291
 Rwy ID: 30 Lgth: 8000 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: FULLY GROOVED Rwy Status: WET
 Category: L OFF Phase: LND XDistance: 2230 YDistance: R 100
 REMARKS: X DISTANCE IS TO TOUCHDOWN. Y DISTANCE IS GREATEST DISTANCE THAT AIRCRAFT WAS FROM CENTERLINE. AIRCRAFT TOUCHED DOWN PARTIALLY OFF RUNWAY, LEFT RUNWAY ENTIRELY, AND THEN RETURNED TO RUNWAY AT 3431' FROM THRESHOLD. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER INFLIGHT PLANNING AND PROCEDURES NOT FOLLOWED.

02/07/83 GREER, SC Arpt Name: GREENVILLE-SPARTANBURG (GSP) Owner Name: EASTERN AIRLINES Acft Mfr: MCDONNEUL-DOUGLAS/DC-9-50
 Rwy ID: 3 Lgth: 7600 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 1830 YDistance: R 110
 REMARKS: AIRCRAFT INITIALLY TOUCHED DOWN PARTIALLY ON RUNWAY 1300' FROM THRESHOLD BUT CONTINUED ROLLOUT UNTIL IT WAS ENTIRELY OFF RUNWAY. AIRCRAFT BECAME AIRBORNE AT 1800' FROM THRESHOLD AND CONTINUED TO CHARLOTTE, NC. FURTHEST DISTANCE FROM R/W CENTERLINE WAS CALCULATED TO BE 110'. INSTRUMENT METEOROLOGICAL CONDITIONS. MISSED APPROACH DELAYED.

07/21/84 TAU, MANUA ISL, AS Arpt Name: TAU (H13) Owner Name: SOUTH PACIFIC ISLAND Acft Mfr: DEHAVILLAND/DHC-6-300
 Rwy ID: 36 Lgth: 2170 Wid: 100 Operator Name/DBA: SOUTH PACIFIC ISLAND FAR Part: 135 SCHEDULED
 Surface Type: DIRT Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 500 YDistance: L 85
 REMARKS: X AND Y DISTANCES ARE TO AIRCRAFT'S STOPPING POINT. VISUAL METEOROLOGICAL CONDITIONS. MECHANICAL FAILURE.

10/14/84 ERIE, PA Arpt Name: ERIE INT'L (ERI) Owner Name: US AIR Acft Mfr: MCDONNELL-DOUGLAS/DC-9-30
 Rwy ID: 24 Lgth: 6500 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: ROUGH TEXTURE Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 5200 YDistance: R 81
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IFR PROCEDURE NOT FOLLOWED AND MISSED APPROACH NOT PERFORMED.

02/10/85 CHAMPAIGN, IL Arpt Name: WILLARD (CMI) Owner Name: Acft Mfr: MCDONNELL DOUGLAS/DC-9
 Rwy ID: 31 Lgth: 8100 Wid: 150 Operator Name/DBA: OZARK AIR LINES, INC. FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: SNOW-DRY
 Category: L OFF Phase: LND XDistance: 900 YDistance: L 91
 REMARKS: X AND Y DISTANCES ARE TO THE TOUCHDOWN POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. AIRCRAFT ATTEMPTING GO AROUND TOUCHED DOWN THEN BECAME AIRBORNE AGAIN AND CONTINUED TO STL. DELAYED DIRECTIONAL CONTROL AND IMPROPER USE OF PROCEDURE.

12/07/78 ROCKFORD, IL **Arpt Name:** GREATER ROCKFORD () **Owner Name:** **Acft Mfr:** CESSNA/401A
Rwy ID: 36 **Lgth:** 8198 **Wid:** **Operator Name/DBA:** INTERNATL AVI **FAR Part:** 135
Surface Type: MACADAM **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** CND **XDistance:** 837 **YDistance:** R 325
REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER PREFLIGHT.

05/29/82 DETROIT, MI **Arpt Name:** DETROIT METROPOLITAN (DTW) **Owner Name:** PROVIDENCE AIRLINES CORPORATION **Acft Mfr:** CONVAIR/240
Rwy ID: 27 **Lgth:** 8700 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: ASPHALT **Rwy Surface Character:** SMOOTH TEXTURE **Rwy Status:** WET
Category: L OFF **Phase:** LND **XDistance:** UNK **YDistance:** UNK
REMARKS: INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER RAISING OF FLAPS.

08/12/82 NORTH PLATTE, NE **Arpt Name:** LEE BIRD FIELD (LBF) **Owner Name:** FRONTIER AIRLINES **Acft Mfr:** BOEING/737-2291
Rwy ID: 30 **Lgth:** 8000 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** FULLY GROOVED **Rwy Status:** WET
Category: L OFF **Phase:** LND **XDistance:** 2230 **YDistance:** R 100
REMARKS: X DISTANCE IS TO TOUCHDOWN. Y DISTANCE IS GREATEST DISTANCE THAT AIRCRAFT WAS FROM CENTERLINE. AIRCRAFT TOUCHED DOWN PARTIALLY OFF RUNWAY, LEFT RUNWAY ENTIRELY, AND THEN RETURNED TO RUNWAY AT 3431' FROM THRESHOLD. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER INFLIGHT PLANNING AND PROCEDURES NOT FOLLOWED.

02/07/83 GREER, SC **Arpt Name:** GREENVILLE-SPARTANBURG (GSP) **Owner Name:** EASTERN AIRLINES **Acft Mfr:** MCDONNEUL-DOUGLAS/DC-9-50
Rwy ID: 3 **Lgth:** 7600 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 1830 **YDistance:** R 110
REMARKS: AIRCRAFT INITIALLY TOUCHED DOWN PARTIALLY ON RUNWAY 1300' FROM THRESHOLD BUT CONTINUED ROLLOUT UNTIL IT WAS ENTIRELY OFF RUNWAY. AIRCRAFT BECAME AIRBORNE AT 1800' FROM THRESHOLD AND CONTINUED TO CHARLOTTE, NC. FURTHEST DISTANCE FROM R/W CENTERLINE WAS CALCULATED TO BE 110'. INSTRUMENT METEOROLOGICAL CONDITIONS. MISSED APPROACH DELAYED.

07/21/84 TAU, MANUA ISL, AS **Arpt Name:** TAU (H13) **Owner Name:** SOUTH PACIFIC ISLAND **Acft Mfr:** DEHAVILLAND/DHC-6-300
Rwy ID: 36 **Lgth:** 2170 **Wid:** 100 **Operator Name/DBA:** SOUTH PACIFIC ISLAND **FAR Part:** 135 SCHEDULED
Surface Type: DIRT **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 500 **YDistance:** L 85
REMARKS: X AND Y DISTANCES ARE TO AIRCRAFT'S STOPPING POINT. VISUAL METEOROLOGICAL CONDITIONS. MECHANICAL FAILURE.

10/14/84 ERIE, PA **Arpt Name:** ERIE INT'L (ERI) **Owner Name:** US AIR **Acft Mfr:** MCDONNELL-DOUGLAS/DC-9-30
Rwy ID: 24 **Lgth:** 6500 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: ASPHALT **Rwy Surface Character:** ROUGH TEXTURE **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 5200 **YDistance:** R 81
REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IFR PROCEDURE NOT FOLLOWED AND MISSED APPROACH NOT PERFORMED.

02/10/85 CHAMPAIGN, IL **Arpt Name:** WILLARD (CMI) **Owner Name:** **Acft Mfr:** MCDONNELL DOUGLAS/DC-9
Rwy ID: 31 **Lgth:** 8100 **Wid:** 150 **Operator Name/DBA:** OZARK AIR LINES, INC. **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** **Rwy Status:** SNOW-DRY
Category: L OFF **Phase:** LND **XDistance:** 900 **YDistance:** L 91
REMARKS: X AND Y DISTANCES ARE TO THE TOUCHDOWN POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. AIRCRAFT ATTEMPTING GO AROUND TOUCHED DOWN THEN BECAME AIRBORNE AGAIN AND CONTINUED TO STL. DELAYED DIRECTIONAL CONTROL AND IMPROPER USE OF PROCEDURE.

12/07/78 ROCKFORD, IL Arpt Name: GREATER ROCKFORD () Owner Name: Acft Mfr: CESSNA/401A
 Rwy ID: 36 Lgth: 8198 Wid: Operator Name/DBA: INTERNATL AVI FAR Part: 135
 Surface Type: MACADAM Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: CND XDistance: 837 YDistance: R 325
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER PREFLIGHT.

05/29/82 DETROIT, MI Arpt Name: DETROIT METROPOLITAN (DTW) Owner Name: PROVIDENCE AIRLINES CORPORATION Acft Mfr: CONVAIR/240
 Rwy ID: 27 Lgth: 8700 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: SMOOTH TEXTURE Rwy Status: WET
 Category: L OFF Phase: LND XDistance: UNK YDistance: UNK
 REMARKS: INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER RAISING OF FLAPS.

08/12/82 NORTH PLATTE, NE Arpt Name: LEE BIRD FIELD (LBF) Owner Name: FRONTIER AIRLINES Acft Mfr: BOEING/737-2291
 Rwy ID: 30 Lgth: 8000 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: FULLY GROOVED Rwy Status: WET
 Category: L OFF Phase: LND XDistance: 2230 YDistance: R 100
 REMARKS: X DISTANCE IS TO TOUCHDOWN. Y DISTANCE IS GREATEST DISTANCE THAT AIRCRAFT WAS FROM CENTERLINE. AIRCRAFT TOUCHED DOWN PARTIALLY OFF RUNWAY, LEFT RUNWAY ENTIRELY, AND THEN RETURNED TO RUNWAY AT 3431' FROM THRESHOLD. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER INFLIGHT PLANNING AND PROCEDURES NOT FOLLOWED.

02/07/83 GREER, SC Arpt Name: GREENVILLE-SPARTANBURG (GSP) Owner Name: EASTERN AIRLINES Acft Mfr: MCDONNEUL-DOUGLAS/DC-9-50
 Rwy ID: 3 Lgth: 7600 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 1830 YDistance: R 110
 REMARKS: AIRCRAFT INITIALLY TOUCHED DOWN PARTIALLY ON RUNWAY 1300' FROM THRESHOLD BUT CONTINUED ROLLOUT UNTIL IT WAS ENTIRELY OFF RUNWAY. AIRCRAFT BECAME AIRBORNE AT 1800' FROM THRESHOLD AND CONTINUED TO CHARLOTTE, NC. FURTHEST DISTANCE FROM R/W CENTERLINE WAS CALCULATED TO BE 110'. INSTRUMENT METEOROLOGICAL CONDITIONS. MISSED APPROACH DELAYED.

07/21/84 TAUJMANUA ISL, A S Arpt Name: TAU (H13) Owner Name: SOUTH PACIFIC ISLAND Acft Mfr: DEHAVILLAND/DHC-6-300
 Rwy ID: 36 Lgth: 2170 Wid: 100 Operator Name/DBA: SOUTH PACIFIC ISLAND FAR Part: 135 SCHEDULED
 Surface Type: DIRT Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 500 YDistance: L 85
 REMARKS: X AND Y DISTANCES ARE TO AIRCRAFT'S STOPPING POINT. VISUAL METEOROLOGICAL CONDITIONS. MECHANICAL FAILURE.

10/14/84 ERIE, PA Arpt Name: ERIE INT'L (ERI) Owner Name: US AIR Acft Mfr: MCDONNELL-DOUGLAS/DC-9-30
 Rwy ID: 24 Lgth: 6500 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: ROUGH TEXTURE Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 5200 YDistance: R 81
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IFR PROCEDURE NOT FOLLOWED AND MISSED APPROACH NOT PERFORMED.

02/10/85 CHAMPAIGN, IL Arpt Name: WILLARD (CWI) Owner Name: Acft Mfr: MCDONNELL DOUGLAS/DC-9
 Rwy ID: 31 Lgth: 8100 Wid: 150 Operator Name/DBA: OZARK AIR LINES, INC. FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: SNOW-DRY
 Category: L OFF Phase: LND XDistance: 900 YDistance: L 91
 REMARKS: X AND Y DISTANCES ARE TO THE TOUCHDOWN POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. AIRCRAFT ATTEMPTING GO AROUND TOUCHED DOWN THEN BECAME AIRBORNE AGAIN AND CONTINUED TO STL. DELAYED DIRECTIONAL CONTROL AND IMPROPER USE OF PROCEDURE.

12/07/78 ROCKFORD, IL **Arpt Name:** GREATER ROCKFORD () **Owner Name:** **Acft Mfr:** CESSNA/401A
Rwy ID: 36 **Lgth:** 8198 **Wid:** **Operator Name/DBA:** INTERNATL AVI **FAR Part:** 135
Surface Type: MACADAM **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 837 **YDistance:** R 325
REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER PREFLIGHT.

05/29/82 DETROIT, MI **Arpt Name:** DETROIT METROPOLITAN (DTW) **Owner Name:** PROVIDENCE AIRLINES CORPORATION **Acft Mfr:** CONVAIR/240
Rwy ID: 27 **Lgth:** 8700 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: ASPHALT **Rwy Surface Character:** SMOOTH TEXTURE **Rwy Status:** WET
Category: L OFF **Phase:** LND **XDistance:** UNK **YDistance:** UNK
REMARKS: INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER RAISING OF FLAPS.

08/12/82 NORTH PLATTE, NE **Arpt Name:** LEE BIRD FIELD (LBF) **Owner Name:** FRONTIER AIRLINES **Acft Mfr:** BOEING/737-2291
Rwy ID: 30 **Lgth:** 8000 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** FULLY GROOVED **Rwy Status:** WET
Category: L OFF **Phase:** LND **XDistance:** 2230 **YDistance:** R 100
REMARKS: X DISTANCE IS TO TOUCHDOWN. Y DISTANCE IS GREATEST DISTANCE THAT AIRCRAFT WAS FROM CENTERLINE. AIRCRAFT TOUCHED DOWN PARTIALLY OFF RUNWAY, LEFT RUNWAY ENTIRELY, AND THEN RETURNED TO RUNWAY AT 3431' FROM THRESHOLD. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER INFLIGHT PLANNING AND PROCEDURES NOT FOLLOWED.

02/07/83 GREER, SC **Arpt Name:** GREENVILLE-SPARTANBURG (GSP) **Owner Name:** EASTERN AIRLINES **Acft Mfr:** MCDONNELL-DOUGLAS/DC-9-30
Rwy ID: 3 **Lgth:** 7600 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 1830 **YDistance:** R 110
REMARKS: AIRCRAFT INITIALLY TOUCHED DOWN PARTIALLY ON RUNWAY 1300' FROM THRESHOLD BUT CONTINUED ROLLOUT UNTIL IT WAS ENTIRELY OFF RUNWAY. AIRCRAFT BECAME AIRBORNE AT 1800' FROM THRESHOLD AND CONTINUED TO CHARLOTTE, NC. FURTHEST DISTANCE FROM R/W CENTERLINE WAS CALCULATED TO BE 110'. INSTRUMENT METEOROLOGICAL CONDITIONS. MISSED APPROACH DELAYED.

07/21/84 TAU, MANUA ISL, AS **Arpt Name:** TAU (H13) **Owner Name:** SOUTH PACIFIC ISLAND **Acft Mfr:** DEHAVILLAND/DHC-6-300
Rwy ID: 36 **Lgth:** 2170 **Wid:** 100 **Operator Name/DBA:** SOUTH PACIFIC ISLAND **FAR Part:** 135 SCHEDULED
Surface Type: DIRT **Rwy Surface Character:** **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 500 **YDistance:** L 85
REMARKS: X AND Y DISTANCES ARE TO AIRCRAFT'S STOPPING POINT. VISUAL METEOROLOGICAL CONDITIONS. MECHANICAL FAILURE.

10/14/84 ERIE, PA **Arpt Name:** ERIE INT'L (ERI) **Owner Name:** US AIR **Acft Mfr:** MCDONNELL-DOUGLAS/DC-9-30
Rwy ID: 24 **Lgth:** 6500 **Wid:** 150 **Operator Name/DBA:** **FAR Part:** 121 SCHEDULED
Surface Type: ASPHALT **Rwy Surface Character:** ROUGH TEXTURE **Rwy Status:** DRY
Category: L OFF **Phase:** LND **XDistance:** 5200 **YDistance:** R 81
REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IFR PROCEDURE NOT FOLLOWED AND MISSED APPROACH NOT PERFORMED.

02/10/85 CHAMPAIGN, IL **Arpt Name:** WILLARD (CWI) **Owner Name:** **Acft Mfr:** MCDONNELL DOUGLAS/DC-9
Rwy ID: 31 **Lgth:** 8100 **Wid:** 150 **Operator Name/DBA:** OZARK AIR LINES, INC. **FAR Part:** 121 SCHEDULED
Surface Type: CONCRETE **Rwy Surface Character:** **Rwy Status:** SNOW-DRY
Category: L OFF **Phase:** LND **XDistance:** 900 **YDistance:** L 91
REMARKS: X AND Y DISTANCES ARE TO THE TOUCHDOWN POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. AIRCRAFT ATTEMPTING GO AROUND TOUCHED DOWN THEN BECAME AIRBORNE AGAIN AND CONTINUED TO STL. DELAYED DIRECTIONAL CONTROL AND IMPROPER USE OF PROCEDURE.

12/07/78 ROCKFORD, IL Arpt Name: GREATER ROCKFORD () Owner Name: Acft Mfr: CESSNA/401A
 Rwy ID: 36 Lgth: 8198 Wid: Operator Name/DBA: INTERNATL AVI FAR Part: 135
 Surface Type: MACADAM Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: CND XDistance: 837 YDistance: R 325
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER PREFLIGHT.

05/29/82 DETROIT, MI Arpt Name: DETROIT METROPOLITAN (DTW) Owner Name: PROVIDENCE AIRLINES CORPORATION Acft Mfr: CONVAIR/240
 Rwy ID: 27 Lgth: 8700 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: SMOOTH TEXTURE Rwy Status: WET
 Category: L OFF Phase: LND XDistance: UNK YDistance: UNK
 REMARKS: INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER RAISING OF FLAPS.

08/12/82 NORTH PLATTE, NE Arpt Name: LEE BIRD FIELD (LBF) Owner Name: FRONTIER AIRLINES Acft Mfr: BOEING/737-2291
 Rwy ID: 30 Lgth: 8000 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: FULLY GROOVED Rwy Status: WET
 Category: L OFF Phase: LND XDistance: 2230 YDistance: R 100
 REMARKS: X DISTANCE IS TO TOUCHDOWN. Y DISTANCE IS GREATEST DISTANCE THAT AIRCRAFT WAS FROM CENTERLINE. AIRCRAFT TOUCHED DOWN PARTIALLY OFF RUNWAY, LEFT RUNWAY ENTIRELY, AND THEN RETURNED TO RUNWAY AT 3431' FROM THRESHOLD. INSTRUMENT METEOROLOGICAL CONDITIONS. IMPROPER INFIGHT PLANNING AND PROCEDURES NOT FOLLOWED.

02/07/83 GREER, SC Arpt Name: GREENVILLE-SPARTANBURG (GSP) Owner Name: EASTERN AIRLINES Acft Mfr: MCDONNEUL-DOUGLAS/DC-9-50
 Rwy ID: 3 Lgth: 7600 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 1830 YDistance: R 110
 REMARKS: AIRCRAFT INITIALLY TOUCHED DOWN PARTIALLY ON RUNWAY 1300' FROM THRESHOLD BUT CONTINUED ROLLOUT UNTIL IT WAS ENTIRELY OFF RUNWAY. AIRCRAFT BECAME AIRBORNE AT 1800' FROM THRESHOLD AND CONTINUED TO CHARLOTTE, NC. FURTHEST DISTANCE FROM R/W CENTERLINE WAS CALCULATED TO BE 110'. INSTRUMENT METEOROLOGICAL CONDITIONS. MISSED APPROACH DELAYED.

07/21/84 TAUJMANUA ISL, A S Arpt Name: TAU (H13) Owner Name: SOUTH PACIFIC ISLAND Acft Mfr: DEHAVILLAND/DHC-6-300
 Rwy ID: 36 Lgth: 2170 Wid: 100 Operator Name/DBA: SOUTH PACIFIC ISLAND FAR Part: 135 SCHEDULED
 Surface Type: DIRT Rwy Surface Character: Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 500 YDistance: L 85
 REMARKS: X AND Y DISTANCES ARE TO AIRCRAFT'S STOPPING POINT. VISUAL METEOROLOGICAL CONDITIONS. MECHANICAL FAILURE.

10/14/84 ERIE, PA Arpt Name: ERIE INT'L (ERI) Owner Name: US AIR Acft Mfr: MCDONNELL-DOUGLAS/DC-9-30
 Rwy ID: 24 Lgth: 6500 Wid: 150 Operator Name/DBA: FAR Part: 121 SCHEDULED
 Surface Type: ASPHALT Rwy Surface Character: ROUGH TEXTURE Rwy Status: DRY
 Category: L OFF Phase: LND XDistance: 5200 YDistance: R 81
 REMARKS: X AND Y DISTANCES ARE TO THE AIRCRAFT'S STOPPING POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. IFR PROCEDURE NOT FOLLOWED AND MISSED APPROACH NOT PERFORMED.

02/10/85 CHAMPAIGN, IL Arpt Name: WILLARD (CWI) Owner Name: Acft Mfr: MCDONNELL DOUGLAS/DC-9
 Rwy ID: 31 Lgth: 8100 Wid: 150 Operator Name/DBA: OZARK AIR LINES, INC. FAR Part: 121 SCHEDULED
 Surface Type: CONCRETE Rwy Surface Character: Rwy Status: SNOW-DRY
 Category: L OFF Phase: LND XDistance: 900 YDistance: L 91
 REMARKS: X AND Y DISTANCES ARE TO THE TOUCHDOWN POINT. INSTRUMENT METEOROLOGICAL CONDITIONS. AIRCRAFT ATTEMPTING GO AROUND TOUCHED DOWN THEN BECAME AIRBORNE AGAIN AND CONTINUED TO STL. DELAYED DIRECTIONAL CONTROL AND IMPROPER USE OF PROCEDURE.

07/25/79	ETIWOOD, MO	Arpt Name: FORNEY AAF ()	Owner Name:	Acft Mfr: BEECH/E18S
Rwy ID: 14	Lgth: 5008	Wid: 150	Operator Name/DBA: SKYWAY AVIATION	FAR Part: 135
Surface Type: MACADAM		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: L UNK
10/08/79	CRESTED BUTTE, CO	Arpt Name: CRESTED BUTTE ()	Owner Name:	Acft Mfr: BRITTNORMA/BN2A-9
Rwy ID: 29	Lgth: 4500	Wid: 90	Operator Name/DBA: CRESTED BUTTE	FAR Part: 135
Surface Type: GRAVEL		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: T/O	XDistance: A1300	YDistance: UNK
10/14/79	PANAMA CTY, PM	Arpt Name: TOCUMEN ()	Owner Name:	Acft Mfr: DOUGLAS/DC-8
Rwy ID: 3 R	Lgth: 10000	Wid: 148	Operator Name/DBA: BRANIFF INT'L	FAR Part: 121
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: B6700	YDistance: D R 174
10/24/79	MINNEAPOLIS, MN	Arpt Name: MINNEAPOLIS-ST P ()	Owner Name:	Acft Mfr: BEECH/99
Rwy ID:	Lgth:	Wid: 150	Operator Name/DBA: MESABA AIRWAY	FAR Part: 135
Surface Type:		Rwy Status:	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
10/31/79	THIEF RIV FLS, MN	Arpt Name: THIEF RIV FLS RE ()	Owner Name:	Acft Mfr: CONVAIR/580
Rwy ID: 31	Lgth: 6500	Wid: 150	Operator Name/DBA: REPUBLIC AIRLINES	FAR Part: 121
Surface Type: MACADAM		Rwy Status: SLUSHCOVERED	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A2000 B3000	YDistance: D L 125
11/05/79	TAU, AS	Arpt Name: TAU ()	Owner Name:	Acft Mfr: DEHAVILLAND/DHC-6
Rwy ID:	Lgth: 1620	Wid: 100	Operator Name/DBA: SOUTH PACIFIC	FAR Part: 135
Surface Type: CORAL		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
11/24/79	FREEPORT, BA	Arpt Name: ()	Owner Name:	Acft Mfr: CONVAIR/440
Rwy ID:	Lgth: 11000	Wid:	Operator Name/DBA: MACKEY INTERNATIONAL	FAR Part: 121
Surface Type:		Rwy Status:	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A4000	YDistance: D L 225
01/17/80	LA CROSSE, WI	Arpt Name: LA CROSSE MUNI ()	Owner Name:	Acft Mfr: BEECH/99
Rwy ID: 31	Lgth: 5298	Wid: 150	Operator Name/DBA: MISSISSIPPI V	FAR Part: 135
Surface Type: MACADAM		Rwy Status: SLUSH COVERED	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
03/06/80	SOUTH NAKNEK, AK	Arpt Name: SOUTH NAKNEK NR ()	Owner Name:	Acft Mfr: CESSNA/207
Rwy ID: 30	Lgth: 2600	Wid: 85	Operator Name/DBA: KODIAK WESTER	FAR Part: 135
Surface Type: GRAVEL		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A 870 B1680	YDistance: D R 135
06/19/80	ATLANTA, GA	Arpt Name: HARTSFIELD INTL ()	Owner Name:	Acft Mfr: SUD AVN/SE-210
Rwy ID: 26	Lgth: 10000	Wid: 150	Operator Name/DBA: AIRBORNE EXPRESS	FAR Part: 121
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A2100 B4526	YDistance: D L 250

07/25/79	ET WOOD, IHO	Arpt Name: FORNEY AAF ()	Owner Name:	Acft Mfr: BEECH/E18S
Rwy ID: 14	Lgth: 5008	Wid: 150	Operator Name/DBA: SKYWAY AVIATION	FAR Part: 135
Surface Type: MACADAM		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: L UNK
10/08/79	CRESTED BUTTE, CO	Arpt Name: CRESTED BUTTE ()	Owner Name:	Acft Mfr: BRITTNORMA/BN2A-9
Rwy ID: 29	Lgth: 4500	Wid: 90	Operator Name/DBA: CRESTED BUTTE	FAR Part: 135
Surface Type: GRAVEL		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: T/O	XDistance: A1300	YDistance: UNK
10/14/79	PANAMA CTY, PM	Arpt Name: TOCUMEN ()	Owner Name:	Acft Mfr: DOUGLAS/DC-8
Rwy ID: 3 R	Lgth: 10000	Wid: 148	Operator Name/DBA: BRANIFF INT'L	FAR Part: 121
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: B6700	YDistance: D R 174
10/24/79	MINNEAPOLIS, MN	Arpt Name: MINNEAPOLIS-ST P ()	Owner Name:	Acft Mfr: BEECH/99
Rwy ID:	Lgth:	Wid: 150	Operator Name/DBA: MESABA AIRWAY	FAR Part: 135
Surface Type:		Rwy Status:	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
10/31/79	THIEF RIV FLS, MN	Arpt Name: THIEF RIV FLS RE ()	Owner Name:	Acft Mfr: CONVAIR/580
Rwy ID: 31	Lgth: 6500	Wid: 150	Operator Name/DBA: REPUBLIC AIRLINES	FAR Part: 121
Surface Type: MACADAM		Rwy Status: SLUSHCOVERED	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A2000 B3000	YDistance: D L 125
11/05/79	TAU, AS	Arpt Name: TAU ()	Owner Name:	Acft Mfr: DEHAVILLAND/DHC-6
Rwy ID:	Lgth: 1620	Wid: 100	Operator Name/DBA: SOUTH PACIFIC	FAR Part: 135
Surface Type: CORAL		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
11/24/79	FREEPORT, BA	Arpt Name: ()	Owner Name:	Acft Mfr: CONVAIR/440
Rwy ID:	Lgth: 11000	Wid:	Operator Name/DBA: MACKEY INTERNATIONAL	FAR Part: 121
Surface Type:		Rwy Status:	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A4000	YDistance: D L 225
01/17/80	LA CROSSE, WI	Arpt Name: LA CROSSE MUNI ()	Owner Name:	Acft Mfr: BEECH/99
Rwy ID: 31	Lgth: 5298	Wid: 150	Operator Name/DBA: MISSISSIPPI V	FAR Part: 135
Surface Type: MACADAM		Rwy Status: SLUSH COVERED	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: UNK	YDistance: UNK
03/06/80	SOUTH NAKNEK, AK	Arpt Name: SOUTH NAKNEK NR ()	Owner Name:	Acft Mfr: CESSNA/207
Rwy ID: 30	Lgth: 2600	Wid: 85	Operator Name/DBA: KODIAK WESTER	FAR Part: 135
Surface Type: GRAVEL		Rwy Status: WET	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A 870 B1680	YDistance: D R 135
06/19/80	ATLANTA, GA	Arpt Name: HARTSFIELD INTL ()	Owner Name:	Acft Mfr: SUD AVN/SE-210
Rwy ID: 26	Lgth: 10000	Wid: 150	Operator Name/DBA: AIRBORNE EXPRESS	FAR Part: 121
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: VEER		Phase: LND	XDistance: A2100 B4526	YDistance: D L 250

07/25/79 EFT WOOD, MO
Rwy ID: 14 Lgth: 5008
Surface Type: MACADAM
Category: VEER

Arpt Name: FORNEY AAF ()
Wid: 150
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: SKYWAY AVIATION
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/E185
FAR Part: 135

YDistance: L UNK

10/08/79 CRESTED BUTTE, CO
Rwy ID: 29 Lgth: 4500
Surface Type: GRAVEL
Category: VEER

Arpt Name: CRESTED BUTTE ()
Wid: 90
Rwy Status: DRY
Phase: T/O

Owner Name:
Operator Name/DBA: CRESTED BUTTE
Rwy Surface Character:
XDistance: A1300

Acft Mfr: BRITTNORMA/BN2A-9
FAR Part: 135

YDistance: UNK

10/14/79 PANAMA CTY, PM
Rwy ID: 3 R Lgth: 10000
Surface Type: CONCRETE
Category: VEER

Arpt Name: TOCUMEN ()
Wid: 148
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: BRANIFF INT'L
Rwy Surface Character:
XDistance: B6700

Acft Mfr: DOUGLAS/DC-8
FAR Part: 121

YDistance: D R 174

10/24/79 MINNEAPOLIS, MN
Rwy ID: Lgth:
Surface Type:
Category: VEER

Arpt Name: MINNEAPOLIS-ST P ()
Wid: 150
Rwy Status:
Phase: LND

Owner Name:
Operator Name/DBA: MESABA AIRWAY
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/99
FAR Part: 135

YDistance: UNK

10/31/79 THIEF RIV FLS, MN
Rwy ID: 31 Lgth: 6500
Surface Type: MACADAM
Category: VEER

Arpt Name: THIEF RIV FLS RE ()
Wid: 150
Rwy Status: SLUSHCOVERED
Phase: LND

Owner Name:
Operator Name/DBA: REPUBLIC AIRLINES
Rwy Surface Character:
XDistance: A2000 B3000

Acft Mfr: CONVAIR/580
FAR Part: 121

YDistance: D L 125

11/05/79 TAU, AS
Rwy ID: Lgth: 1620
Surface Type: CORAL
Category: VEER

Arpt Name: TAU ()
Wid: 100
Rwy Status: DRY
Phase: LND

Owner Name:
Operator Name/DBA: SOUTH PACIFIC
Rwy Surface Character:
XDistance: UNK

Acft Mfr: DEHAVILLAND/DHC-6
FAR Part: 135

YDistance: UNK

11/24/79 FREEPORT, BA
Rwy ID: Lgth: 11000
Surface Type:
Category: VEER

Arpt Name: ()
Wid:
Rwy Status:
Phase: LND

Owner Name:
Operator Name/DBA: MACKEY INTERNATIONAL
Rwy Surface Character:
XDistance: A4000

Acft Mfr: CONVAIR/440
FAR Part: 121

YDistance: D L 225

01/17/80 LA CROSSE, WI
Rwy ID: 31 Lgth: 5298
Surface Type: MACADAM
Category: VEER

Arpt Name: LA CROSSE MUNI ()
Wid: 150
Rwy Status: SLUSH COVERED
Phase: LND

Owner Name:
Operator Name/DBA: MISSISSIPPI V
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/99
FAR Part: 135

YDistance: UNK

03/06/80 SOUTH NAKNEK, AK
Rwy ID: 30 Lgth: 2600
Surface Type: GRAVEL
Category: VEER

Arpt Name: SOUTH NAKNEK NR ()
Wid: 85
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: KODIAK WESTER
Rwy Surface Character:
XDistance: A 870 B1680

Acft Mfr: CESSNA/207
FAR Part: 135

YDistance: D R 135

06/19/80 ATLANTA, GA
Rwy ID: 26 Lgth: 10000
Surface Type: CONCRETE
Category: VEER

Arpt Name: HARTSFIELD INTL ()
Wid: 150
Rwy Status: DRY
Phase: LND

Owner Name:
Operator Name/DBA: AIRBORNE EXPRESS
Rwy Surface Character:
XDistance: A2100 B4526

Acft Mfr: SUD AVN/SE-210
FAR Part: 121

YDistance: D L 250

07/25/79 EFT WOOD, MO
Rwy ID: 14 Lgth: 5008
Surface Type: MACADAM
Category: VEER

Arpt Name: FORNEY AAF ()
Wid: 150
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: SKYWAY AVIATION
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/E185
FAR Part: 135

YDistance: L UNK

10/08/79 CRESTED BUTTE, CO
Rwy ID: 29 Lgth: 4500
Surface Type: GRAVEL
Category: VEER

Arpt Name: CRESTED BUTTE ()
Wid: 90
Rwy Status: DRY
Phase: T/O

Owner Name:
Operator Name/DBA: CRESTED BUTTE
Rwy Surface Character:
XDistance: A1300

Acft Mfr: BRITTNORMA/BN2A-9
FAR Part: 135

YDistance: UNK

10/14/79 PANAMA CTY, PM
Rwy ID: 3 R Lgth: 10000
Surface Type: CONCRETE
Category: VEER

Arpt Name: TOCUMEN ()
Wid: 148
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: BRANIFF INT'L
Rwy Surface Character:
XDistance: B6700

Acft Mfr: DOUGLAS/DC-8
FAR Part: 121

YDistance: D R 174

10/24/79 MINNEAPOLIS, MN
Rwy ID: Lgth:
Surface Type:
Category: VEER

Arpt Name: MINNEAPOLIS-ST P ()
Wid: 150
Rwy Status:
Phase: LND

Owner Name:
Operator Name/DBA: MESABA AIRWAY
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/99
FAR Part: 135

YDistance: UNK

10/31/79 THIEF RIV FLS, MN
Rwy ID: 31 Lgth: 6500
Surface Type: MACADAM
Category: VEER

Arpt Name: THIEF RIV FLS RE ()
Wid: 150
Rwy Status: SLUSHCOVERED
Phase: LND

Owner Name:
Operator Name/DBA: REPUBLIC AIRLINES
Rwy Surface Character:
XDistance: A2000 B3000

Acft Mfr: CONVAIR/580
FAR Part: 121

YDistance: D L 125

11/05/79 TAU, AS
Rwy ID: Lgth: 1620
Surface Type: CORAL
Category: VEER

Arpt Name: TAU ()
Wid: 100
Rwy Status: DRY
Phase: LND

Owner Name:
Operator Name/DBA: SOUTH PACIFIC
Rwy Surface Character:
XDistance: UNK

Acft Mfr: DEHAVILLAND/DHC-6
FAR Part: 135

YDistance: UNK

11/24/79 FREEPORT, BA
Rwy ID: Lgth: 11000
Surface Type:
Category: VEER

Arpt Name: ()
Wid:
Rwy Status:
Phase: LND

Owner Name:
Operator Name/DBA: MACKEY INTERNATIONAL
Rwy Surface Character:
XDistance: A4000

Acft Mfr: CONVAIR/440
FAR Part: 121

YDistance: D L 225

01/17/80 LA CROSSE, WI
Rwy ID: 31 Lgth: 5298
Surface Type: MACADAM
Category: VEER

Arpt Name: LA CROSSE MUNI ()
Wid: 150
Rwy Status: SLUSH COVERED
Phase: LND

Owner Name:
Operator Name/DBA: MISSISSIPPI V
Rwy Surface Character:
XDistance: UNK

Acft Mfr: BEECH/99
FAR Part: 135

YDistance: UNK

03/06/80 SOUTH NAKNEK, AK
Rwy ID: 30 Lgth: 2600
Surface Type: GRAVEL
Category: VEER

Arpt Name: SOUTH NAKNEK NR ()
Wid: 85
Rwy Status: WET
Phase: LND

Owner Name:
Operator Name/DBA: KODIAK WESTER
Rwy Surface Character:
XDistance: A 870 B1680

Acft Mfr: CESSNA/207
FAR Part: 135

YDistance: D R 135

06/19/80 ATLANTA, GA
Rwy ID: 26 Lgth: 10000
Surface Type: CONCRETE
Category: VEER

Arpt Name: HARTSFIELD INTL ()
Wid: 150
Rwy Status: DRY
Phase: LND

Owner Name:
Operator Name/DBA: AIRBORNE EXPRESS
Rwy Surface Character:
XDistance: A2100 B4526

Acft Mfr: SUD AVN/SE-210
FAR Part: 121

YDistance: D L 250

1.1111

01/14/84 DURANGO, CO Rwy ID: 2 Lgth: 9200 Surface Type: ASPHALT Category: VEER	Arprt Name: LA PLATA COUNTY (DRO) Wid: 150 Rwy Status: ICE COVERED SNOW-DRY Phase: LND	Owner Name: COMMUTER AIRLINES OF CO. Operator Name/DBA: TRANS COLORADO AIRLINE Rwy Surface Character: XDistance: A1700B2300	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: D L 85
01/23/84 CHI CAGO, IL Rwy ID: 9 L Lgth: 7416 Surface Type: ASPHALT Category: VEER	Arprt Name: O' HARE IAP (ORD) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: UNITED AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: B 400	Acft Mfr: MCDONNEUL DOUGLAS/DC-8-61 FAR Part: 121 SCHEDULED YDistance: UNK
02/15/84 TULSA, OK Rwy ID: 17 L Lgth: 10000 Surface Type: ASPHALT Category: VEER	Arprt Name: TULSA INT'L (TUL) Wid: 200 Rwy Status: DRY Phase: LND	Owner Name: TRANSCENTRAL AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: A2800	Acft Mfr: NIHOWYES-11 FAR Part: 121 SCHEDULED YDistance: D L 140
06/13/84 DETROIT, MI Rwy ID: 21 R Lgth: 10501 Surface Type: CONCRETE Category: VEER	Arprt Name: DETROIT METRO (DTW) Wid: 200 Rwy Status: WET Phase: LND	Owner Name: US AIR, INC. Operator Name/DBA: Rwy Surface Character: ROUGH TEXTURE FULLY GROOVED XDistance: B6300	Acft Mfr: MCDONNEUL DOUGLAS/DC-9-31 FAR Part: 121 SCHEDULED YDistance: D L 200
06/29/84 GRAND ISLAND, NE Rwy ID: 17 Lgth: 7001 Surface Type: ASPHALT Category: VEER	Arprt Name: HALL COUNTY REGINAL (GRI) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: UNITED BANK OF DENVER NAT'L Operator Name/DBA: PIONEER AIRWAYS, INC. (PIDA) Rwy Surface Character: XDistance: UNK	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: UNK
07/03/84 DENVER, CO Rwy ID: 26 L Lgth: 10010 Surface Type: CONCRETE Category: VEER	Arprt Name: STAPLETON INT'L (DEN) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: B8100	Acft Mfr: BOEING/727-23 FAR Part: 121 SCHEDULED YDistance: D L 105
09/29/84 HOUSTON, TX Rwy ID: 14 R Lgth: 6048 Surface Type: CONCRETE Category: VEER	Arprt Name: HOUSTON INTERNATIONAL (IAH) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: METROFLIGHT INC. Operator Name/DBA: METROFLIGHT, INC. Rwy Surface Character: XDistance: UNK	Acft Mfr: DEHAVILLAND/DHC-6-300 FAR Part: 135 SCHEDULED YDistance: L UNK
11/29/84 PULLMAN, WA Rwy ID: 23 Lgth: 6731 Surface Type: ASPHALT Category: VEER	Arprt Name: PULLMAN-MOSCOW (PUW) Wid: 100 Rwy Status: SNOW-WET Phase: LND	Owner Name: HOUSTON ACFT LEASING Operator Name/DBA: CASCADE AIRWAYS, INC. Rwy Surface Character: SMOOTH XDistance: A2335 C3600	Acft Mfr: FAIRCHILD-SWEARINGEN/SA 227 FAR Part: 121 SCHEDULED YDistance: E R 60
12/16/84 JASPER, AL Rwy ID: 27 Lgth: 4800 Surface Type: MACADAM Category: VEER	Arprt Name: WALKER COUNTY (L02) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: FLIGHT TRAILS Operator Name/DBA: FLIGHT TRAILS Rwy Surface Character: XDistance: A1000 B3000	Acft Mfr: CONVAIR/440 FAR Part: 121 NW-SCHEDULED YDistance: D R 50
12/17/84 POINT HOPE, AK Rwy ID: 19 Lgth: 4000 Surface Type: GRAVEL Category: VEER	Arprt Name: POINT HOPE (PHO) Wid: 100 Rwy Status: SNOW-DRY Phase: T/O	Owner Name: BAKER AVIATION, INC Operator Name/DBA: BAKER AVIATION, INC. Rwy Surface Character: XDistance: A3660 B3900	Acft Mfr: CESSNA/U206 FAR Part: 135 SCHEDULED YDistance: D L 60

1.1111

01/14/84 DURANGO, CO Rwy ID: 2 Lgth: 9200 Surface Type: ASPHALT Category: VEER	Arprt Name: LA PLATA COUNTY (DRO) Wid: 150 Rwy Status: ICE COVERED SNOW-DRY Phase: LND	Owner Name: COMMUTER AIRLINES OF CO. Operator Name/DBA: TRANS COLORADO AIRLINE Rwy Surface Character: XDistance: A1700B2300	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: D L 85
01/23/84 CHI CAGO, IL Rwy ID: 9 L Lgth: 7416 Surface Type: ASPHALT Category: VEER	Arprt Name: O' HARE IAP (ORD) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: UNITED AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: B 400	Acft Mfr: MCDONNEUL DOUGLAS/DC-8-61 FAR Part: 121 SCHEDULED YDistance: UNK
02/15/84 TULSA, OK Rwy ID: 17 L Lgth: 10000 Surface Type: ASPHALT Category: VEER	Arprt Name: TULSA INT'L (TUL) Wid: 200 Rwy Status: DRY Phase: LND	Owner Name: TRANSCENTRAL AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: A2800	Acft Mfr: NIHOWYES-11 FAR Part: 121 SCHEDULED YDistance: D L 140
06/13/84 DETROIT, MI Rwy ID: 21 R Lgth: 10501 Surface Type: CONCRETE Category: VEER	Arprt Name: DETROIT METRO (DTW) Wid: 200 Rwy Status: WET Phase: LND	Owner Name: US AIR, INC. Operator Name/DBA: Rwy Surface Character: ROUGH TEXTURE FULLY GROOVED XDistance: B6300	Acft Mfr: MCDONNEUL DOUGLAS/DC-9-31 FAR Part: 121 SCHEDULED YDistance: D L 200
06/29/84 GRAND ISLAND, NE Rwy ID: 17 Lgth: 7001 Surface Type: ASPHALT Category: VEER	Arprt Name: HALL COUNTY REGINAL (GRI) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: UNITED BANK OF DENVER NAT'L Operator Name/DBA: PIONEER AIRWAYS, INC. (PIDA) Rwy Surface Character: XDistance: UNK	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: UNK
07/03/84 DENVER, CO Rwy ID: 26 L Lgth: 10010 Surface Type: CONCRETE Category: VEER	Arprt Name: STAPLETON INT'L (DEN) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: B8100	Acft Mfr: BOEING/727-23 FAR Part: 121 SCHEDULED YDistance: D L 105
09/29/84 HOUSTON, TX Rwy ID: 14 R Lgth: 6048 Surface Type: CONCRETE Category: VEER	Arprt Name: HOUSTON INTERNATIONAL (IAH) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: METROFLIGHT INC. Operator Name/DBA: METROFLIGHT, INC. Rwy Surface Character: XDistance: UNK	Acft Mfr: DEHAVILLAND/DHC-6-300 FAR Part: 135 SCHEDULED YDistance: L UNK
11/29/84 PULLMAN, WA Rwy ID: 23 Lgth: 6731 Surface Type: ASPHALT Category: VEER	Arprt Name: PULLMAN-MOSCOW (PUW) Wid: 100 Rwy Status: SNOW-WET Phase: LND	Owner Name: HOUSTON ACFT LEASING Operator Name/DBA: CASCADE AIRWAYS, INC. Rwy Surface Character: SMOOTH XDistance: A2335 C3600	Acft Mfr: FAIRCHILD-SWEARINGEN/SA 227 FAR Part: 121 SCHEDULED YDistance: E R 60
12/16/84 JASPER, AL Rwy ID: 27 Lgth: 4800 Surface Type: MACADAM Category: VEER	Arprt Name: WALKER COUNTY (L02) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: FLIGHT TRAILS Operator Name/DBA: FLIGHT TRAILS Rwy Surface Character: XDistance: A1000 B3000	Acft Mfr: CONVAIR/440 FAR Part: 121 NW-SCHEDULED YDistance: D R 50
12/17/84 POINT HOPE, AK Rwy ID: 19 Lgth: 4000 Surface Type: GRAVEL Category: VEER	Arprt Name: POINT HOPE (PHO) Wid: 100 Rwy Status: SNOW-DRY Phase: T/O	Owner Name: BAKER AVIATION, INC Operator Name/DBA: BAKER AVIATION, INC. Rwy Surface Character: XDistance: A3660 B3900	Acft Mfr: CESSNA/U206 FAR Part: 135 SCHEDULED YDistance: D L 60

1.1111

01/14/84 DURANGO, CO Rwy ID: 2 Lgth: 9200 Surface Type: ASPHALT Category: VEER	Arpt Name: LA PLATA COUNTY (DRO) Wid: 150 Rwy Status: ICE COVERED SNOW-DRY Phase: LND	Owner Name: COMMUTER AIRLINES OF CO. Operator Name/DBA: TRANS COLORADO AIRLINE Rwy Surface Character: XDistance: A1700B2300	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: D L 85
01/23/84 CHI CAGO, IL Rwy ID: 9 L Lgth: 7416 Surface Type: ASPHALT Category: VEER	Arpt Name: O' HARE IAP (ORD) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: UNITED AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: B 400	Acft Mfr: MCDONNEUL DOUGLAS/DC-8-61 FAR Part: 121 SCHEDULED YDistance: UNK
02/15/84 TULSA, OK Rwy ID: 17 L Lgth: 10000 Surface Type: ASPHALT Category: VEER	Arpt Name: TULSA INT'L (TUL) Wid: 200 Rwy Status: DRY Phase: LND	Owner Name: TRANSCENTRAL AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: A2800	Acft Mfr: NIHOWYES-11 FAR Part: 121 SCHEDULED YDistance: D L 140
06/13/84 DETROIT, MI Rwy ID: 21 R Lgth: 10501 Surface Type: CONCRETE Category: VEER	Arpt Name: DETROIT METRO (DTW) Wid: 200 Rwy Status: WET Phase: LND	Owner Name: US AIR, INC. Operator Name/DBA: Rwy Surface Character: ROUGH TEXTURE FULLY GROOVED XDistance: B6300	Acft Mfr: MCDONNEUL DOUGLAS/DC-9-31 FAR Part: 121 SCHEDULED YDistance: D L 200
06/29/84 GRAND ISLAND, NE Rwy ID: 17 Lgth: 7001 Surface Type: ASPHALT Category: VEER	Arpt Name: HALL COUNTY REGINAL (GRI) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: UNITED BANK OF DENVER NAT'L Operator Name/DBA: PIONEER AIRWAYS, INC. (PIDA) Rwy Surface Character: XDistance: UNK	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: UNK
07/03/84 DENVER, CO Rwy ID: 26 L Lgth: 10010 Surface Type: CONCRETE Category: VEER	Arpt Name: STAPLETON INT'L (DEN) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: B8100	Acft Mfr: BOEING/727-23 FAR Part: 121 SCHEDULED YDistance: D L 105
09/29/84 HOUSTON, TX Rwy ID: 14 R Lgth: 6048 Surface Type: CONCRETE Category: VEER	Arpt Name: HOUSTON INTERNATIONAL (IAH) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: METROFLIGHT INC. Operator Name/DBA: METROFLIGHT, INC. Rwy Surface Character: XDistance: UNK	Acft Mfr: DEHAVILLAND/DHC-6-300 FAR Part: 135 SCHEDULED YDistance: L UNK
11/29/84 PULLMAN, WA Rwy ID: 23 Lgth: 6731 Surface Type: ASPHALT Category: VEER	Arpt Name: PULLMAN-MOSCOW (PUW) Wid: 100 Rwy Status: SNOW-WET Phase: LND	Owner Name: HOUSTON ACFT LEASING Operator Name/DBA: CASCADE AIRWAYS, INC. Rwy Surface Character: SMOOTH XDistance: A2335 C3600	Acft Mfr: FAIRCHILD-SWEARINGEN/SA 227 FAR Part: 121 SCHEDULED YDistance: E R 60
12/16/84 JASPER, AL Rwy ID: 27 Lgth: 4800 Surface Type: MACADAM Category: VEER	Arpt Name: WALKER COUNTY (L02) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: FLIGHT TRAILS Operator Name/DBA: FLIGHT TRAILS Rwy Surface Character: XDistance: A1000 B3000	Acft Mfr: CONVAIR/440 FAR Part: 121 NW-SCHEDULED YDistance: D R 50
12/17/84 POINT HOPE, AK Rwy ID: 19 Lgth: 4000 Surface Type: GRAVEL Category: VEER	Arpt Name: POINT HOPE (PHO) Wid: 100 Rwy Status: SNOW-DRY Phase: T/O	Owner Name: BAKER AVIATION, INC Operator Name/DBA: BAKER AVIATION, INC. Rwy Surface Character: XDistance: A3660 B3900	Acft Mfr: CESSNA/U206 FAR Part: 135 SCHEDULED YDistance: D L 60

1.1111

01/14/84 DURANGO, CO Rwy ID: 2 Lgth: 9200 Surface Type: ASPHALT Category: VEER	Arprt Name: LA PLATA COUNTY (DRO) Wid: 150 Rwy Status: ICE COVERED SNOW-DRY Phase: LND	Owner Name: COMMUTER AIRLINES OF CO. Operator Name/DBA: TRANS COLORADO AIRLINE Rwy Surface Character: XDistance: A1700B2300	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: D L 85
01/23/84 CHI CAGO, IL Rwy ID: 9 L Lgth: 7416 Surface Type: ASPHALT Category: VEER	Arprt Name: O' HARE IAP (ORD) Wid: 150 Rwy Status: WET Phase: T/O	Owner Name: UNITED AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: XDistance: B 400	Acft Mfr: MCDONNEUL DOUGLAS/DC-8-61 FAR Part: 121 SCHEDULED YDistance: UNK
02/15/84 TULSA, OK Rwy ID: 17 L Lgth: 10000 Surface Type: ASPHALT Category: VEER	Arprt Name: TULSA INT'L (TUL) Wid: 200 Rwy Status: DRY Phase: LND	Owner Name: TRANSCENTRAL AIRLINE CORP. Operator Name/DBA: Rwy Surface Character: XDistance: A2800	Acft Mfr: NIHOWYS-11 FAR Part: 121 SCHEDULED YDistance: D L 140
06/13/84 DETROIT, MI Rwy ID: 21 R Lgth: 10501 Surface Type: CONCRETE Category: VEER	Arprt Name: DETROIT METRO (DTW) Wid: 200 Rwy Status: WET Phase: LND	Owner Name: US AIR, INC. Operator Name/DBA: Rwy Surface Character: ROUGH TEXTURE FULLY GROOVED XDistance: B6300	Acft Mfr: MCDONNEUL DOUGLAS/DC-9-31 FAR Part: 121 SCHEDULED YDistance: D L 200
06/29/84 GRAND ISLAND, NE Rwy ID: 17 Lgth: 7001 Surface Type: ASPHALT Category: VEER	Arprt Name: HALL COUNTY REGINAL (GRI) Wid: 150 Rwy Status: DRY Phase: T/O	Owner Name: UNITED BANK OF DENVER NAT'L Operator Name/DBA: PIONEER AIRWAYS, INC. (PIDA) Rwy Surface Character: XDistance: UNK	Acft Mfr: SWEARINGEN/SA227-KC FAR Part: 135 SCHEDULED YDistance: UNK
07/03/84 DENVER, CO Rwy ID: 26 L Lgth: 10010 Surface Type: CONCRETE Category: VEER	Arprt Name: STAPLETON INT'L (DEN) Wid: 150 Rwy Status: DRY Phase: LND	Owner Name: AMERICAN AIRLINES, INC. Operator Name/DBA: Rwy Surface Character: FULLY GROOVED XDistance: B8100	Acft Mfr: BOEING/727-23 FAR Part: 121 SCHEDULED YDistance: D L 105
09/29/84 HOUSTON, TX Rwy ID: 14 R Lgth: 6048 Surface Type: CONCRETE Category: VEER	Arprt Name: HOUSTON INTERNATIONAL (IAH) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: METROFLIGHT INC. Operator Name/DBA: METROFLIGHT, INC. Rwy Surface Character: XDistance: UNK	Acft Mfr: DEHAVILLAND/DHC-6-300 FAR Part: 135 SCHEDULED YDistance: L UNK
11/29/84 PULLMAN, WA Rwy ID: 23 Lgth: 6731 Surface Type: ASPHALT Category: VEER	Arprt Name: PULLMAN-MOSCOW (PUW) Wid: 100 Rwy Status: SNOW-WET Phase: LND	Owner Name: HOUSTON ACFT LEASING Operator Name/DBA: CASCADE AIRWAYS, INC. Rwy Surface Character: SMOOTH XDistance: A2335 C3600	Acft Mfr: FAIRCHILD-SWEARINGEN/SA 227 FAR Part: 121 SCHEDULED YDistance: E R 60
12/16/84 JASPER, AL Rwy ID: 27 Lgth: 4800 Surface Type: MACADAM Category: VEER	Arprt Name: WALKER COUNTY (L02) Wid: 100 Rwy Status: DRY Phase: LND	Owner Name: FLIGHT TRAILS Operator Name/DBA: FLIGHT TRAILS Rwy Surface Character: XDistance: A1000 B3000	Acft Mfr: CONVAIR/440 FAR Part: 121 NW-SCHEDULED YDistance: D R 50
12/17/84 POINT HOPE, AK Rwy ID: 19 Lgth: 4000 Surface Type: GRAVEL Category: VEER	Arprt Name: POINT HOPE (PHO) Wid: 100 Rwy Status: SNOW-DRY Phase: T/O	Owner Name: BAKER AVIATION, INC Operator Name/DBA: BAKER AVIATION, INC. Rwy Surface Character: XDistance: A3660 B3900	Acft Mfr: CESSNA/U206 FAR Part: 135 SCHEDULED YDistance: D L 60

Date	Location	Runway ID	Length	Surface Type	Category	Arprt Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	XDistance	Acft Mfr	FAR Part	Scheduled	YDistance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O	PAN AMERICAN WORLD AIRWAYS			421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O	UNITED AIRLINES INC.		FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

Date	Location	Runway ID	Length	Surface Type	Category	Arprt Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	XDistance	Acft Mfr	FAR Part	Scheduled	YDistance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O	PAN AMERICAN WORLD AIRWAYS			421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O	UNITED AIRLINES INC.		FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

Date	Location	Runway ID	Length	Surface Type	Category	Runway Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	X Distance	Aircraft Manufacturer	Part Number	Schedule	Y Distance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O		PAN AMERICAN WORLD AIRWAYS		421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O		UNITED AIRLINES INC.	FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

Date	Location	Runway ID	Length	Surface Type	Category	Runway Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	X Distance	Aircraft Manufacturer	Part Number	Schedule	Y Distance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O		PAN AMERICAN WORLD AIRWAYS		421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O		UNITED AIRLINES INC.	FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

Date	Location	Runway ID	Length	Surface Type	Category	Arprt Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	XDistance	Acft Mfr	FAR Part	Scheduled	YDistance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O	PAN AMERICAN WORLD AIRWAYS			421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O	UNITED AIRLINES INC.		FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

Date	Location	Runway ID	Length	Surface Type	Category	Runway Name	Width	Status	Phase	Owner Name	Operator Name/DBA	Surface Character	X Distance	Aircraft Manufacturer	FAR Part	Schedule	Y Distance
08/17/81	FT. LAUDERDALE, FL		8048	MACADAM	OVER	FT. LAUDERDALE (O)		WET	T/O		PAN AMERICAN WORLD AIRWAYS		421	BOEING/727	121		L 215
01/23/82	BOSTON, MA	15	9191	CONCRETE	OVER	BOSTON LOGAN INT'L (O)	150	WET	LND	WORLD AIRWAYS, INC.			250	MCDONNELL DOUGLAS/DC-10-30	121	SCHEDULED	L 110
02/03/82	PHILADELPHIA, PA	9	9500	ASPHALT	OVER	PHILADELPHIA INTL (PHL)	150	WET	T/O		UNITED AIRLINES INC.	FULLY GROOVED	1220	MCDONNELL DOUGLAS/DC-10-10	121	SCHEDULED	R 25
02/15/82	LOS ANGELES**, CA	25 L	11096		OVER	LOS ANGELES INT'L (LAX)	200		LND	CONNECTICUT BANK & TRUST CO.	AIRCAL		UNK	BOEING/B737-2H4	121		UNK
02/19/82	HARLINGEN, TX	17	8300	CONCRETE	OVER	HARLINGEN IND. AIR PARK (HRL)	150	WATER COVERED	LND	MEXICANA AIRLINES		SMOOTH TEXTURE	300	BOEING/B-727-200	121	SCHEDULED	UNK
07/05/82	BOISE, ID	28	9763	ASPHALT	OVER	BOISE AIR TERMINAL (BOI)	190	DRY	T/O	REPUBLIC AIRLINES WEST, INC.		SMOOTH TEXTURE	50	DOUGLAS/DC-9-31	121	SCHEDULED	UNK
11/26/82	GUSTAVUS, AK	1	5400	ASPHALT	OVER	GUSTAVUS (GST)	340	SNOW-WET	T/O	LAYTON A. BENNETT		SMOOTH TEXTURE	UNK	PIPER/PA-32R-300	135	SCHEDULED	UNK
12/18/82	PELLSTON, MI	32	6512	ASPHALT	OVER	EMMET COUNTY AIRPORT (PLN)	150	ICE COVERED	LND	REPUBLIC AIRLINES, INC.			80	DOUGLAS/DC-9-30	121	SCHEDULED	0
12/23/83	ANCHORAGE, AK	24 R	10600	ASPHALT	OVER	ANCHORAGE INT'L. (ANC)	200	ICE COVERED SNOW-COMPACTED	T/O	KOREAN AIR LINES			1434	MCDONNELL DOUGLAS/DC-10-30C	129	SCHEDULED	R 40
02/28/84	JAMAICA, NY	4 R	10000	ASPHALT	OVER	JOHN F KENNEDY INTL (JFK)	150	WET	LND	DET NORSKE LUFTFARTSSLEKAB	SCANDINAVIAN AIRLINES		560	MCDONNELL DOUGLAS/DC-10-30	129	SCHEDULED	0

08/30/79 MIDDLETOWN, PA Rwy ID: Lgth: 9501 Surface Type: MACADAM Category: OTHER	Arpt Name: HARRISBURG INTL () Wid: Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: KEYSTONE AVIA Rwy Surface Character: XDistance: 8892	Acft Mfr: BEECH/58 FAR Part: 135 YDistance: 0
09/19/79 SUFFIELD, CT Rwy ID: Lgth: 5246 Surface Type: CONCRETE Category: OTHER	Arpt Name: BRADLEY INTL () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: MOUNTAIN AIR Rwy Surface Character: XDistance: 2600	Acft Mfr: BEECH/E18S FAR Part: 135 YDistance: L1100
10/08/79 COVINGTON, KY Rwy ID: Lgth: 9500 Surface Type: MACADAM Category: OTHER	Arpt Name: GRTR CINCINNATI () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: COMAIR, INC. Rwy Surface Character: XDistance: 8695	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1189
11/02/79 GREENVILLE, SC Rwy ID: Lgth: 5393 Surface Type: MACADAM Category: OTHER	Arpt Name: GREENVILLE DUNTW () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: BANKAIR, INC Rwy Surface Character: XDistance: *1M NW APT	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
11/16/79 TUSAYAN, AZ Rwy ID: Lgth: 9000 Surface Type: MACADAM Category: OTHER	Arpt Name: GRAND CANYON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: Rwy Surface Character: XDistance: 7531	Acft Mfr: MARTIN/404 FAR Part: 121 YDistance: L2447
01/18/80 ST.CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EASTERN CARIB Rwy Surface Character: XDistance: *1.5M SSE	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
02/29/80 MONB, UT Rwy ID: Lgth: 6901 Surface Type: MACADAM Category: OTHER	Arpt Name: CANYONLANDS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: TRANSWESTERN Rwy Surface Character: XDistance: 963	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: 0
03/21/80 HOUSTON, TX Rwy ID: Lgth: 7602 Surface Type: CONCRETE Category: OTHER	Arpt Name: WILLIAM P. HOBBS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EAGLE COMMUTE Rwy Surface Character: XDistance: 6500 APP	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1275
05/12/80 FORT WORTH, TX Rwy ID: Lgth: 250 Surface Type: Category: OTHER	Arpt Name: MANGHAM () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ASAP AIR, INC Rwy Surface Character: XDistance: 500	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: UNK
06/18/80 ALDER CREEK, AK Rwy ID: Lgth: 1800 Surface Type: DIRT Category: OTHER	Arpt Name: ALDER CREEK () Wid: Rwy Status: ROUGH Phase: T/O	Owner Name: Operator Name/DBA: AIR NORTH Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/207 FAR Part: 135 YDistance: UNK

08/30/79 MIDDLETOWN, PA Rwy ID: Lgth: 9501 Surface Type: MACADAM Category: OTHER	Arpt Name: HARRISBURG INTL () Wid: Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: KEYSTONE AVIA Rwy Surface Character: XDistance: 8892	Acft Mfr: BEECH/58 FAR Part: 135 YDistance: 0
09/19/79 SUFFIELD, CT Rwy ID: Lgth: 5246 Surface Type: CONCRETE Category: OTHER	Arpt Name: BRADLEY INTL () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: MOUNTAIN AIR Rwy Surface Character: XDistance: 2600	Acft Mfr: BEECH/E18S FAR Part: 135 YDistance: L1100
10/08/79 COVINGTON, KY Rwy ID: Lgth: 9500 Surface Type: MACADAM Category: OTHER	Arpt Name: GRTR CINCINNATI () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: COMAIR, INC. Rwy Surface Character: XDistance: 8695	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1189
11/02/79 GREENVILLE, SC Rwy ID: Lgth: 5393 Surface Type: MACADAM Category: OTHER	Arpt Name: GREENVILLE DUNTW () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: BANKAIR, INC Rwy Surface Character: XDistance: *1M NW APT	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
11/16/79 TUSAYAN, AZ Rwy ID: Lgth: 9000 Surface Type: MACADAM Category: OTHER	Arpt Name: GRAND CANYON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: Rwy Surface Character: XDistance: 7531	Acft Mfr: MARTIN/404 FAR Part: 121 YDistance: L2447
01/18/80 ST. CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EASTERN CARIB Rwy Surface Character: XDistance: *1.5M SSE	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
02/29/80 MONB, UT Rwy ID: Lgth: 6901 Surface Type: MACADAM Category: OTHER	Arpt Name: CANYONLANDS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: TRANSWESTERN Rwy Surface Character: XDistance: 963	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: 0
03/21/80 HOUSTON, TX Rwy ID: Lgth: 7602 Surface Type: CONCRETE Category: OTHER	Arpt Name: WILLIAM P. HOBBS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EAGLE COMMUTE Rwy Surface Character: XDistance: 6500 APP	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1275
05/12/80 FORT WORTH, TX Rwy ID: Lgth: 250 Surface Type: Category: OTHER	Arpt Name: MANGHAM () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ASAP AIR, INC Rwy Surface Character: XDistance: 500	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: UNK
06/18/80 ALDER CREEK, AK Rwy ID: Lgth: 1800 Surface Type: DIRT Category: OTHER	Arpt Name: ALDER CREEK () Wid: Rwy Status: ROUGH Phase: T/O	Owner Name: Operator Name/DBA: AIR NORTH Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/207 FAR Part: 135 YDistance: UNK

08/30/79 MIDDLETOWN, PA Rwy ID: Lgth: 9501 Surface Type: MACADAM Category: OTHER	Arpt Name: HARRISBURG INTL () Wid: Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: KEYSTONE AVIA Rwy Surface Character: XDistance: 8892	Acft Mfr: BEECH/58 FAR Part: 135 YDistance: 0
09/19/79 SUFFIELD, CT Rwy ID: Lgth: 5246 Surface Type: CONCRETE Category: OTHER	Arpt Name: BRADLEY INTL () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: MOUNTAIN AIR Rwy Surface Character: XDistance: 2600	Acft Mfr: BEECH/E18S FAR Part: 135 YDistance: L1100
10/08/79 COVINGTON, KY Rwy ID: Lgth: 9500 Surface Type: MACADAM Category: OTHER	Arpt Name: GRTR CINCINNATI () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: COMAIR, INC. Rwy Surface Character: XDistance: 8695	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1189
11/02/79 GREENVILLE, SC Rwy ID: Lgth: 5393 Surface Type: MACADAM Category: OTHER	Arpt Name: GREENVILLE DUNTW () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: BANKAIR, INC Rwy Surface Character: XDistance: *1M NW APT	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
11/16/79 TUSAYAN, AZ Rwy ID: Lgth: 9000 Surface Type: MACADAM Category: OTHER	Arpt Name: GRAND CANYON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: Rwy Surface Character: XDistance: 7531	Acft Mfr: MARTIN/404 FAR Part: 121 YDistance: L2447
01/18/80 ST. CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EASTERN CARIB Rwy Surface Character: XDistance: *1.5M SSE	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
02/29/80 MONB, UT Rwy ID: Lgth: 6901 Surface Type: MACADAM Category: OTHER	Arpt Name: CANYONLANDS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: TRANSWESTERN Rwy Surface Character: XDistance: 963	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: 0
03/21/80 HOUSTON, TX Rwy ID: Lgth: 7602 Surface Type: CONCRETE Category: OTHER	Arpt Name: WILLIAM P. HOBBS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EAGLE COMMUTE Rwy Surface Character: XDistance: 6500 APP	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1275
05/12/80 FORT WORTH, TX Rwy ID: Lgth: 250 Surface Type: Category: OTHER	Arpt Name: MANGHAM () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ASAP AIR, INC Rwy Surface Character: XDistance: 500	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: UNK
06/18/80 ALDER CREEK, AK Rwy ID: Lgth: 1800 Surface Type: DIRT Category: OTHER	Arpt Name: ALDER CREEK () Wid: Rwy Status: ROUGH Phase: T/O	Owner Name: Operator Name/DBA: AIR NORTH Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/207 FAR Part: 135 YDistance: UNK

08/30/79 MIDDLETOWN, PA Rwy ID: Lgth: 9501 Surface Type: MACADAM Category: OTHER	Arpt Name: HARRISBURG INTL () Wid: Rwy Status: DRY Phase: LND	Owner Name: Operator Name/DBA: KEYSTONE AVIA Rwy Surface Character: XDistance: 8892	Acft Mfr: BEECH/58 FAR Part: 135 YDistance: 0
09/19/79 SUFFIELD, CT Rwy ID: Lgth: 5246 Surface Type: CONCRETE Category: OTHER	Arpt Name: BRADLEY INTL () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: MOUNTAIN AIR Rwy Surface Character: XDistance: 2600	Acft Mfr: BEECH/E18S FAR Part: 135 YDistance: L1100
10/08/79 COVINGTON, KY Rwy ID: Lgth: 9500 Surface Type: MACADAM Category: OTHER	Arpt Name: GRTR CINCINNATI () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: COMAIR, INC. Rwy Surface Character: XDistance: 8695	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1189
11/02/79 GREENVILLE, SC Rwy ID: Lgth: 5393 Surface Type: MACADAM Category: OTHER	Arpt Name: GREENVILLE DUNTW () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: BANKAIR, INC Rwy Surface Character: XDistance: *1M NW APT	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
11/16/79 TUSAYAN, AZ Rwy ID: Lgth: 9000 Surface Type: MACADAM Category: OTHER	Arpt Name: GRAND CANYON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: Rwy Surface Character: XDistance: 7531	Acft Mfr: MARTIN/404 FAR Part: 121 YDistance: L2447
01/18/80 ST. CROIX, VI Rwy ID: Lgth: 7612 Surface Type: MACADAM Category: OTHER	Arpt Name: ALEX HAMILTON () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EASTERN CARIB Rwy Surface Character: XDistance: *1.5M SSE	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance:
02/29/80 MONB, UT Rwy ID: Lgth: 6901 Surface Type: MACADAM Category: OTHER	Arpt Name: CANYONLANDS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: TRANSWESTERN Rwy Surface Character: XDistance: 963	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: 0
03/21/80 HOUSTON, TX Rwy ID: Lgth: 7602 Surface Type: CONCRETE Category: OTHER	Arpt Name: WILLIAM P. HOBBS () Wid: Rwy Status: DRY Phase: T/O	Owner Name: Operator Name/DBA: EAGLE COMMUTE Rwy Surface Character: XDistance: 6500 APP	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: R1275
05/12/80 FORT WORTH, TX Rwy ID: Lgth: 250 Surface Type: Category: OTHER	Arpt Name: MANGHAM () Wid: Rwy Status: WET Phase: T/O	Owner Name: Operator Name/DBA: ASAP AIR, INC Rwy Surface Character: XDistance: 500	Acft Mfr: PIPER/PA-31 FAR Part: 135 YDistance: UNK
06/18/80 ALDER CREEK, AK Rwy ID: Lgth: 1800 Surface Type: DIRT Category: OTHER	Arpt Name: ALDER CREEK () Wid: Rwy Status: ROUGH Phase: T/O	Owner Name: Operator Name/DBA: AIR NORTH Rwy Surface Character: XDistance: UNK	Acft Mfr: CESSNA/207 FAR Part: 135 YDistance: UNK

02/05/85	PHILADELPHIA, PA	Arprt Name: PHILADELPHIA INTL (PHL)	Owner Name: AIRBORNE EXPRESS, INC.	Acft Mfr: MODONNEL D DOUGLAS DC-9-35
Rwy ID: 9 L	Lgth: 9500	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: SNOW COMPACTED	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: UNK	YDistance: UNK
02/06/85	ALTUS, OK	Arprt Name: ALTUS AFB (LTS)	Owner Name: ALTUS AIRLINE, INC	Acft Mfr: CESSNA/402B
Rwy ID: 17	Lgth:	Wid:	Operator Name/DBA: ALTUS AIRLINE, INC	FAR Part: 135 SCHEDULED
Surface Type:		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *1.5 NNE	YDistance:
04/06/85	NANTUCKET, MA	Arprt Name: NANTUCKET (ACK)	Owner Name: RICHARD K. & DAWN DERRIDINGER	Acft Mfr: PIPER/PA-31-310
Rwy ID: 24	Lgth: 6303	Wid: 50	Operator Name/DBA: NANTUCKET AIRCRAFT MAIN., INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: 3711	YDistance: 1 192
05/17/85	LATROBE, PA	Arprt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arprt Name: NASHVILLE METRO (BNA)	Owner Name: TAG	Acft Mfr: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arprt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NW-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
08/02/85	DALLAS/FORT WORTH, TX	Arprt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr: LOCKHEED/C-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/25/85	AUBURN, ME	Arprt Name: AUBURN-LEWISTON MUNI (O)	Owner Name: BAR HARBOR AIRLINES	Acft Mfr: BEECH/W
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
09/06/85	MILWAUKEE, WI	Arprt Name: GENERAL MITCHELL FIELD (MKE)	Owner Name: MIDWEST EXPRESS AIRLINES, INC.	Acft Mfr: DOUGLAS/DC-9-14
Rwy ID: 19 R	Lgth: 9690	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character: SMOOTH FULLY GROOVED	
Category: OTHER		Phase: T/O	XDistance: 1320	YDistance: R1040
11/01/85	BETHEL, AK	Arprt Name: BETHEL (BET)	Owner Name: HERMENS AIR, INC.	Acft Mfr: CESSNA/208
Rwy ID: 18	Lgth: 6399	Wid: 150	Operator Name/DBA: HERMENS AIR, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 931	YDistance: R1993

02/05/85	PHILADELPHIA, PA	Arprt Name: PHILADELPHIA INTL (PHL)	Owner Name: AIRBORNE EXPRESS, INC.	Acft Mfr: McDONNELL-DOUGLAS/DC-9-115
Rwy ID: 9 L	Lgth: 9500	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: SNOW/COMPACTED	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: UNK	YDistance: UNK
02/06/85	ALTUS, OK	Arprt Name: ALTUS AFB (LTS)	Owner Name: ALTUS AIRLINE, INC	Acft Mfr: CESSNA/402B
Rwy ID: 17	Lgth:	Wid:	Operator Name/DBA: ALTUS AIRLINE, INC	FAR Part: 135 SCHEDULED
Surface Type:		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *1.5 NNE	YDistance:
04/06/85	NANTUCKET, MA	Arprt Name: NANTUCKET (ACK)	Owner Name: RICHARD K. & DAWN DERRIDINGER	Acft Mfr: PIPER/PA-31-310
Rwy ID: 24	Lgth: 6303	Wid: 50	Operator Name/DBA: NANTUCKET AIRCRAFT MAIN., INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: 3711	YDistance: 1 192
05/17/85	LATROBE, PA	Arprt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arprt Name: NASHVILLE METRO (BNA)	Owner Name: TAG	Acft Mfr: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arprt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NW-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
08/02/85	DALLAS/FORT WORTH, TX	Arprt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr: LOCKHEED/C-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/25/85	AUBURN, ME	Arprt Name: AUBURN-LEWISTON MUNI (A)	Owner Name: BAR HARBOR AIRLINES	Acft Mfr: BEECH/W
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
09/06/85	MILWAUKEE, WI	Arprt Name: GENERAL MITCHELL FIELD (MKE)	Owner Name: MIDWEST EXPRESS AIRLINES, INC.	Acft Mfr: DOUGLAS/DC-9-114
Rwy ID: 19 R	Lgth: 9690	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character: SMOOTH FULLY GROOVED	
Category: OTHER		Phase: T/O	XDistance: 1320	YDistance: R1040
11/01/85	BETHEL, AK	Arprt Name: BETHEL (BET)	Owner Name: HERMENS AIR, INC.	Acft Mfr: CESSNA/208
Rwy ID: 18	Lgth: 6399	Wid: 150	Operator Name/DBA: HERMENS AIR, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 931	YDistance: R1993

02/05/85	PHILADELPHIA, PA	Arprt Name: PHILADELPHIA INTL (PHL)	Owner Name: AIRBORNE EXPRESS, INC.	Acft Mfr: McDONNELL-DOUGLAS/DC-9-115
Rwy ID: 9 L	Lgth: 9500	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: SNOW/COMPACTED	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: UNK	YDistance: UNK
02/06/85	ALTUS, OK	Arprt Name: ALTUS AFB (LTS)	Owner Name: ALTUS AIRLINE, INC	Acft Mfr: CESSNA/402B
Rwy ID: 17	Lgth:	Wid:	Operator Name/DBA: ALTUS AIRLINE, INC	FAR Part: 135 SCHEDULED
Surface Type:		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *1.5 NNE	YDistance:
04/06/85	NANTUCKET, MA	Arprt Name: NANTUCKET (ACK)	Owner Name: RICHARD K. & DAWN DERRIDINGER	Acft Mfr: PIPER/PA-31-310
Rwy ID: 24	Lgth: 6303	Wid: 50	Operator Name/DBA: NANTUCKET AIRCRAFT MAIN., INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: 3711	YDistance: 1 192
05/17/85	LATROBE, PA	Arprt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arprt Name: NASHVILLE METRO (BNA)	Owner Name: TAG	Acft Mfr: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arprt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NW-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
08/02/85	DALLAS/FORT WORTH, TX	Arprt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr: LOCKHEED/C-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/25/85	AUBURN, ME	Arprt Name: AUBURN-LEWISTON MUNI (A)	Owner Name: BAR HARBOR AIRLINES	Acft Mfr: BEECH/W
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
09/06/85	MILWAUKEE, WI	Arprt Name: GENERAL MITCHELL FIELD (MKE)	Owner Name: MIDWEST EXPRESS AIRLINES, INC.	Acft Mfr: DOUGLAS/DC-9-114
Rwy ID: 19 R	Lgth: 9690	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character: SMOOTH FULLY GROOVED	
Category: OTHER		Phase: T/O	XDistance: 1320	YDistance: R1040
11/01/85	BETHEL, AK	Arprt Name: BETHEL (BET)	Owner Name: HERMENS AIR, INC.	Acft Mfr: CESSNA/208
Rwy ID: 18	Lgth: 6399	Wid: 150	Operator Name/DBA: HERMENS AIR, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 931	YDistance: R1993

02/05/85	PHILADELPHIA, PA	Arprt Name: PHILADELPHIA INTL (PHL)	Owner Name: AIRBORNE EXPRESS, INC.	Acft Mfr: McDONNELL-DOUGLAS/DC-9-115
Rwy ID: 9 L	Lgth: 9500	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: SNOW/COMPACTED	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: UNK	YDistance: UNK
02/06/85	ALTUS, OK	Arprt Name: ALTUS AFB (LTS)	Owner Name: ALTUS AIRLINE, INC	Acft Mfr: CESSNA/402B
Rwy ID: 17	Lgth:	Wid:	Operator Name/DBA: ALTUS AIRLINE, INC	FAR Part: 135 SCHEDULED
Surface Type:		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *1.5 NNE	YDistance:
04/06/85	NANTUCKET, MA	Arprt Name: NANTUCKET (ACK)	Owner Name: RICHARD K. & DAWN DERRIDINGER	Acft Mfr: PIPER/PA-31-310
Rwy ID: 24	Lgth: 6303	Wid: 50	Operator Name/DBA: NANTUCKET AIRCRAFT MAIN., INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: 3711	YDistance: 1 192
05/17/85	LATROBE, PA	Arprt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.8M SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arprt Name: NASHVILLE METRO (BNA)	Owner Name: TAG	Acft Mfr: GULFSTREAM/G-159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: L1720
06/19/85	WEST TRENTON, NJ	Arprt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NW-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: L2000
08/02/85	DALLAS/FORT WORTH, TX	Arprt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr: LOCKHEED/C-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/25/85	AUBURN, ME	Arprt Name: AUBURN-LEWISTON MUNI (A)	Owner Name: BAR HARBOR AIRLINES	Acft Mfr: BEECH/W
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
09/06/85	MILWAUKEE, WI	Arprt Name: GENERAL MITCHELL FIELD (MKE)	Owner Name: MIDWEST EXPRESS AIRLINES, INC.	Acft Mfr: DOUGLAS/DC-9-114
Rwy ID: 19 R	Lgth: 9690	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character: SMOOTH FULLY GROOVED	
Category: OTHER		Phase: T/O	XDistance: 1320	YDistance: R1040
11/01/85	BETHEL, AK	Arprt Name: BETHEL (BET)	Owner Name: HERMENS AIR, INC.	Acft Mfr: CESSNA/208
Rwy ID: 18	Lgth: 6399	Wid: 150	Operator Name/DBA: HERMENS AIR, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 931	YDistance: R1993

02/05/85	PHILADELPHIA, PA	Arprt Name: PHILADELPHIA INTL (PHL)	Owner Name: AIRBORNE EXPRESS, INC.	Acft Mfr: McDONNELL-DOUGLAS/DC-9-115
Rwy ID: 9 L	Lgth: 9500	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: SNOW/COMPACTED	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: UNK	YDistance: UNK
02/06/85	ALTUS, OK	Arprt Name: ALTUS AFB (LTS)	Owner Name: ALTUS AIRLINE, INC	Acft Mfr: CESSNA/402B
Rwy ID: 17	Lgth:	Wid:	Operator Name/DBA: ALTUS AIRLINE, INC.	FAR Part: 135 SCHEDULED
Surface Type:		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *1.5 NNE	YDistance:
04/06/85	NANTUCKET, MA	Arprt Name: NANTUCKET (ACK)	Owner Name: RICHARD K. & DAWN DERRIDINGER	Acft Mfr: PIPER/PA-31-310
Rwy ID: 24	Lgth: 6303	Wid: 50	Operator Name/DBA: NANTUCKET AIRCRAFT MAIN., INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: 3711	YDistance: 1 192
05/17/85	LATROBE, PA	Arprt Name: WESTMORELAND COUNTY (LBE)	Owner Name: CUMBERLAND AIRLINES	Acft Mfr: PIPER/PA-31-350
Rwy ID: 23	Lgth: 5501	Wid: 100	Operator Name/DBA: CUMBERLAND AIRLINES	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character:	
Category: OTHER		Phase: LND	XDistance: *3.84 SE APT	YDistance:
05/31/85	NASHVILLE, TN	Arprt Name: NASHVILLE METRO (BNA)	Owner Name: TAG	Acft Mfr: GULFSTREAM/G-1159
Rwy ID: 20 R	Lgth: 7700	Wid: 150	Operator Name/DBA: GENERAL AVIATION, INC.	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 100	YDistance: 11720
06/19/85	WEST TRENTON, NJ	Arprt Name: MERCER COUNTY (TTN)	Owner Name: PROVIDENCE AIRLINE CORP.	Acft Mfr: GENERAL DYNAMICS/240-27
Rwy ID: 24	Lgth: 6006	Wid: 150	Operator Name/DBA:	FAR Part: 121 NW-SCHEDULED
Surface Type: CONCRETE		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 5280	YDistance: 12000
08/02/85	DALLAS/FORT WORTH, TX	Arprt Name: DALLAS/FORT WORTH INTL (DFW)	Owner Name: DELTA AIRLINES, INC.	Acft Mfr: LOCKHEED/C-1011-385-11
Rwy ID: 17 L	Lgth: 11388	Wid: 150	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: CONCRETE		Rwy Status: WET	Rwy Surface Character: FULLY GROOVED	
Category: OTHER		Phase: LND	XDistance: 6336	YDistance: L 360
08/25/85	AUBURN, ME	Arprt Name: AUBURN-LEWISTON MUNI (A)	Owner Name: BAR HARBOR AIRLINES	Acft Mfr: BEECH/W
Rwy ID: 4	Lgth: 5000	Wid: 75	Operator Name/DBA:	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: WET	Rwy Surface Character: POROUS SMOOTH	
Category: OTHER		Phase: LND	XDistance: 3246	YDistance: R 441
09/06/85	MILWAUKEE, WI	Arprt Name: GENERAL MITCHELL FIELD (MKE)	Owner Name: MIDWEST EXPRESS AIRLINES, INC.	Acft Mfr: DOUGLAS/DC-9-114
Rwy ID: 19 R	Lgth: 9690	Wid: 200	Operator Name/DBA:	FAR Part: 121 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character: SMOOTH FULLY GROOVED	
Category: OTHER		Phase: T/O	XDistance: 1320	YDistance: R1040
11/01/85	BETHEL, AK	Arprt Name: BETHEL (BET)	Owner Name: HERMENS AIR, INC.	Acft Mfr: CESSNA/208
Rwy ID: 18	Lgth: 6399	Wid: 150	Operator Name/DBA: HERMENS AIR, INC.	FAR Part: 135 SCHEDULED
Surface Type: ASPHALT		Rwy Status: DRY	Rwy Surface Character:	
Category: OTHER		Phase: T/O	XDistance: 931	YDistance: R1993